



# SMT Power Inductors

Shielded Shaped Core - Spyglass Coupled Inductors

## Notes:

1. These high current coupled inductors were designed for (but not limited to) use with the Pulse planar transformer series for use in high density forward converter applications. The inductor provides the output filtering on the main winding, and at the same time provides output filtering on the main winding, and at the same time provides an efficient way to generate an isolated primary side voltage for powering the converter's switching regulator integrated circuit. The above inductors have been tested and approved by Pulse's IC partners and are cited in the appropriate datasheet or evaluation board documentation at these companies. To determine which IC and IC partners are matched with the above Pulse part numbers, please see the IC Cross Reference on the Pulse web page. Other inductance/current ratings and turns ratios may be available. Please contact Pulse Power Applications Engineering for more information.
2. The rated current as listed is either 85% of the saturation current or the heating current depending on which value is lower.
3. The saturation current is the current which causes the inductance to drop by 15% at the stated ambient temperatures (25°C, 100°C).
4. The heating current is the dc current which causes the temperature of the part to increase by approximately 45C. This current is determined by mounting the component on a PCB with a .25" wide, 2oz. equivalent copper traces, and applying the current to the device for 30 minutes with no force air cooling.

5. In high volt\*time applications, additional heating in the component can occur due to core losses in the inductor which may necessitate derating the current in order to limit the temperature rise of the component. In order to determine the approximate total losses (or temperature rise) for a given application both copper and core losses should be taken into account.

Total Copper Loss (P<sub>cu</sub>\_total(W)):

$$P_{cu}(W) = .001 * DCR(m\Omega) * (I_{rms})^2$$

where:

$$I_{rms} = (I_{dc}^2 + (\Delta I/2)^2)^{.5}$$

$\Delta I$  = ripple current through inductor

Core Losses (P<sub>core</sub>(W)):

Use the inductor Voltage versus Core Loss table to determine the approximate core losses




Total Losses:

$$P_{total} = P_{cu\ total} + CoreLoss$$

Temperature Rise:

The approximate temperature rise can be found by looking up the calculated total losses in the Temperature Rise vs. Power Dissipation curve.

\* Contact Pulse for availability

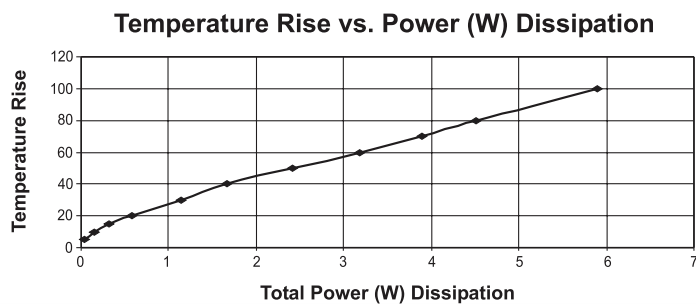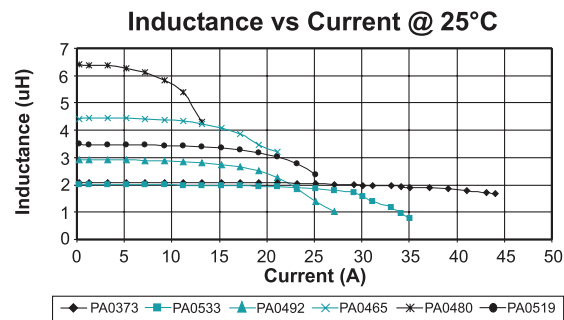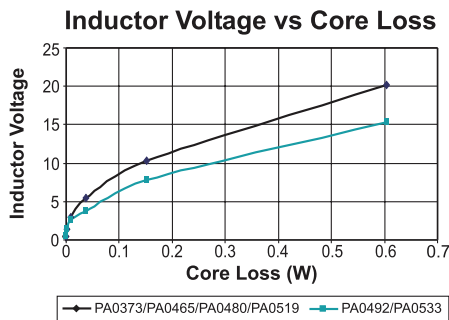

## For More Information

**Pulse Worldwide Headquarters**  
12220 World Trade Drive  
San Diego, CA  
92128  
U.S.A.

**Pulse Europe**  
Einsteinstrasse 1  
D-71083 Herrenberg  
Germany  
Tel: 49 7032 78060  
Fax: 49 7032 7806 135

**Pulse China Headquarters**  
B402, Shenzhen Academy of  
Aerospace Technol-  
ogy Bldg.  
10th Kejian Road  
High-Tech Zone  
Nanshan District  
Shenzhen, PR China  
518057  
Tel: 86 755 33966678  
Fax: 86 755 33966700

**Pulse North China**  
Room 2704/2705  
Super Ocean Finance  
Ctr.  
2067 Yan An Road  
West  
Shanghai 200336  
China  
Tel: 86 21 62787060  
Fax: 86 2162786973

**Pulse South Asia**  
135 Joo Seng Road  
#03-02  
PM Industrial Bldg.  
Singapore 368363  
Tel: 65 6287 8998  
Fax: 65 6287 8998

**Pulse North Asia**  
3F, No. 198  
Zhongyuan Road  
Zhongli City  
Taoyuan County 320  
Taiwan R. O. C.  
Tel: 886 3 4356768  
Fax: 886 3 4356823 (Pulse)  
Fax: 886 3 4356820 (FRE)

Performance warranty of products offered on this data sheet is limited to the parameters specified. Data is subject to change without notice. Other brand and product names mentioned herein may be trademarks or registered trademarks of their respective owners. © Copyright, 2015, Pulse Electronics, Inc. All rights reserved.

单击下面可查看定价，库存，交付和生命周期等信息

[>>Pulse\(普思\)](#)