


Product Features / 產品特性

<b>Operating Temperature</b> 操作溫度	Operating temperature / 操作溫度範圍: -55°C~125°C When choosing the fuses specification, if the operating environmental temperature beyond the scope from 20~30°C, you should consider the environmental temperature's affection to fuses. 若貴司操作環境溫度超出25±5°C範圍，在選用保險絲規格時，需考慮操作環境溫度對保險絲的影響。
<b>Storage Conditions</b> 儲存條件	Under airtight in temperature +10°C~60°C、relative humidity ≤75% can store 3 years. 在溫度+10°C~60°C、相對濕度≤75%的密閉條件下可存放3年。 Without dew in temperature+10°C~60°C、relative humidity be 95% maximum value for 30 days. 在溫度+10°C~60°C、相對濕度為95%的非露天下最多可存放30天。
<b>Installation Way &amp; Parameters</b> 安裝方式及條件	Stud-mount / 螺絲安裝 Wave soldering parameters / 波峰焊 Solder pot temperature / 錫爐溫度: 260±3°C Max Solder dwell time / 焊接時間: 10s Max Hand welding parameters / 手工焊 Solder iron temperature / 烙鐵溫度: 350±5°C Heating time / 焊接時間: 5s Max




Dimensions / 尺寸圖 (Unit / 單位:mm)

WH62-XXX-M6

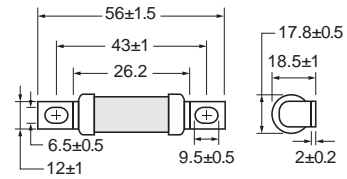

WH62-XXX-M8

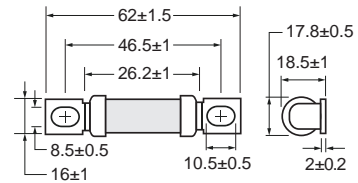

Electrical Characteristics / 電氣特性

Type 品名	Ordering P / N 料號		Rated Current 額定電流	Breaking Capacity 分斷能力	Safety Approvals 安全認證
WH62	WH62-XXX-M6	WH62-XXX-M8			
	WH62-20-M6	WH62-20-M8	20A	150VDC / 10KA	● ●
	WH62-32-M6	WH62-32-M8	32A		● ●
	WH62-50-M6	WH62-50-M8	50A		● ●
	WH62-60-M6	WH62-60-M8	60A		● ●
	WH62-80-M6	WH62-80-M8	80A		● ●
	WH62-100-M6	WH62-100-M8	100A		● ●
	WH62-125-M6	WH62-125-M8	125A		● ●
	WH62-150-M6	WH62-150-M8	150A		● ●
WH62-200-M6	WH62-200-M8	200A	● ●		

单击下面可查看定价，库存，交付和生命周期等信息

[>>Walter\(华德\)](#)