

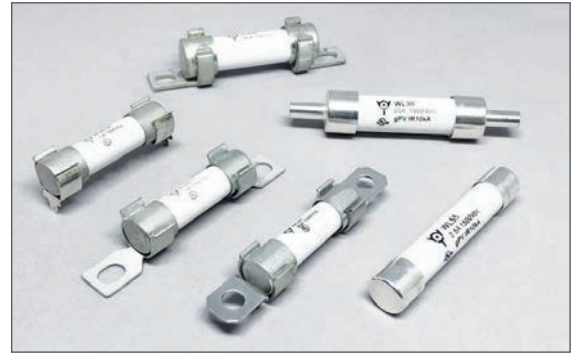
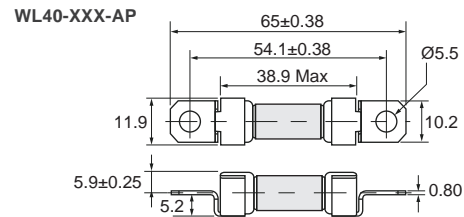


Product Features / 產品特性

Operating Temperature 操作溫度	Operating temperature / 操作溫度範圍：-55°C~125°C When choosing the fuses specification, if the operating environmental temperature beyond the scope from 20~30°C, you should consider the environmental temperature's affection to fuses. 若貴司操作環境溫度超出25±5°C範圍，在選用保險絲規格時，需考慮操作環境溫度對保險絲的影響。
Storage Conditions 儲存條件	Under airtight in temperature +10°C~60°C、relative humidity ≤75% can store 3 years. 在溫度+10°C~60°C、相對濕度≤75%的密閉條件下可存放3年。 Without dew in temperature+10°C~60°C、relative humidity be 95% maximum value for 30 days. 在溫度+10°C~60°C、相對濕度為95%的非露天下最多可存放30天。
Installation Way & Parameters 安裝方式及條件	Stud-mount / 螺柱安裝
	Wave soldering parameters / 波峰焊 Solder pot temperature / 錫爐溫度：260±3°C Max Solder dwell time / 焊接時間：10s Max
	Hand welding parameters / 手工焊 Solder iron temperature / 烙鐵溫度：350±5°C Heating time / 焊接時間：5s Max

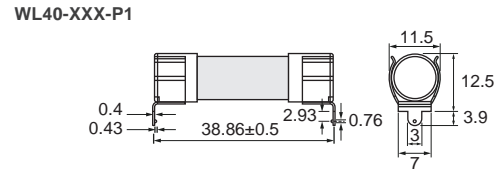

Dimensions / 尺寸圖 (Unit / 單位:mm)



Electrical Characteristics / 電氣特性

Type 品名	Ordering P / N 料號			Rated Current 額定電流	Breaking Capacity 分斷能力	Safety Approvals 安全認證
WL40	WL40-XXX	WL40-XXX-P1	WL40-XXX-AP			
	WL40-0.44	WL40-0.44-P1	WL40-0.44-AP	440mA	1000VAC / 30KA 1000VDC / 30KA	●
	WL40-0.5	WL40-05-P1	WL40-05-AP	500mA		●
	WL40-1	WL40-1-P1	WL40-1-AP	1A		●
	WL40-2	WL40-2-P1	WL40-2-AP	2A		●
	WL40-4	WL40-4-P1	WL40-4-AP	4A		●
	WL40-10	WL40-10-P1	WL40-10-AP	10A		●
	WL40-11	WL40-11-P1	WL40-11-AP	11A		●
	WL40-12	WL40-12-P1	WL40-12-AP	12A		●
WL40-15	WL40-15-P1	WL40-15-AP	15A	●		

单击下面可查看定价，库存，交付和生命周期等信息

[>>Walter\(华德\)](#)