


Product Features / 產品特性

| | |
|---|---|
| Operating Temperature 操作溫度 | Operating temperature / 操作溫度範圍：-55°C~125°C When choosing the fuses specification, if the operating environmental temperature beyond the scope from 20~30°C, you should consider the environmental temperature's affection to fuses. 若貴司操作環境溫度超出25±5°C範圍，在選用保險絲規格時，需考慮操作環境溫度對保險絲的影響。 |
| Storage Conditions 儲存條件 | Under airtight in temperature +10°C~60°C、relative humidity ≤75% can store 3 years. 在溫度+10°C~60°C、相對濕度≤75%的密閉條件下可存放3年。 Without dew in temperature+10°C~60°C、relative humidity be 95% maximum value for 30 days. 在溫度+10°C~60°C、相對濕度為95%的非露天下最多可存放30天。 |
| Installation Way & Parameters 安裝方式及條件 | Stud-mount / 螺柱安裝 |
| | Wave soldering parameters / 波峰焊 |
| | Solder pot temperature / 錫爐溫度：260±3°C Max Solder dwell time / 焊接時間：10s Max |
| | Hand welding parameters / 手工焊 Solder iron temperature / 烙鐵溫度：350±5°C Heating time / 焊接時間：5s Max |



Dimensions / 尺寸圖 (Unit / 單位:mm)

WH42 -XXX-M6

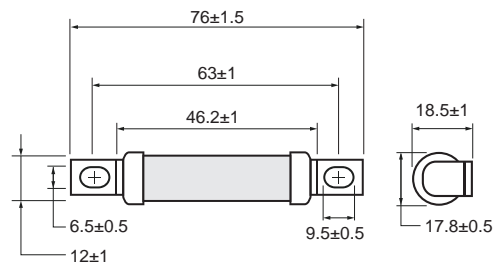

Electrical Characteristics / 電氣特性

| Type 品名 | Ordering P / N 料號 | Rated Current 額定電流 | Breaking Capacity 分斷能力 | Safety Approvals 安全認證 |
|-------------|----------------------|-----------------------|--------------------------------|--------------------------|
| WH42 | WH42-XXX-M6 | | | |
| | WH42-35-M6 | 35A | 700VAC / 50KA 700VDC / 50KA | ● |
| | WH42-40-M6 | 40A | | ● |
| | WH42-50-M6 | 50A | | ● |
| | WH42-60-M6 | 60A | | ● |
| | WH42-70-M6 | 70A | | ● |
| | WH42-80-M6 | 80A | | ● |
| | WH42-90-M6 | 90A | | ● |
| WH42-100-M6 | 100A | ● | | |

单击下面可查看定价，库存，交付和生命周期等信息

[>>Walter\(华德\)](#)