

# SPI Serial EEPROM 8 Kbits (1,024 x 8) and 16 Kbits (2,048 x 8)

# Features

- Serial Peripheral Interface (SPI) Compatible
- Supports SPI Modes 0 (0,0) and 3 (1,1):
  - Data sheet describes mode 0 operation
- Low-Voltage Operation:
  - 1.8V (V<sub>CC</sub> = 1.8V to 5.5V)
- Industrial Temperature Range: -40°C to +85°C
- 20 MHz Clock Rate (5V)
- 32-Byte Page Mode
- Block Write Protection:
  - Protect 1/4, 1/2 or entire array
- Write-Protect (WP) Pin and Write Disable Instructions for Both Hardware and Software Data Protection
- Self-Timed Write Cycle within 5 ms Maximum
- High Reliability:
  - Endurance: 1,000,000 write cycles
  - Data retention: 100 years
- · Green (Lead-free/Halide-free/RoHS Compliant) Package Options
- Die Sale Options: Wafer Form and Bumped Wafers

# Packages


• 8-Lead SOIC, 8-Lead TSSOP, 8-Pad UDFN, 8-Pad XDFN and 8-Ball VFBGA

# **Table of Contents**

Fea	atures	1
Pac	ckages	1
1.	Package Types (not to scale)	4
2.	Pin Description	5
	2.1. Chip Select (CS)	5
	2.2. Serial Data Output (SO)	5
	2.3. Write-Protect (WP)	5
	2.4. Ground (GND)	
	2.5. Serial Data Input (SI)	
	2.6. Serial Data Clock (SCK)	
	2.7. Suspend Serial Input (HOLD)	
	2.8. Device Power Supply (V <sub>CC</sub> )	6
3.	Description	7
	3.1. SPI Bus Master Connections to Serial EEPROMs	7
	3.2. Block Diagram	8
4.	Electrical Characteristics	9
	4.1. Absolute Maximum Ratings	9
	4.2. DC and AC Operating Range	9
	4.3. DC Characteristics	9
	4.4. AC Characteristics	10
	4.5. SPI Synchronous Data Timimg	. 12
	4.6. Electrical Specifications	12
5.	Device Operation	. 15
	5.1. Interfacing the AT25080B/AT25160B on the SPI Bus	15
	5.2. Device Opcodes	16
	5.3. Hold Function	16
	5.4. Write Protection	17
6.	Device Commands and Addressing	18
	6.1. STATUS Register Bit Definition and Function	. 18
	6.2. Read STATUS Register (RDSR)	19
	6.3. Write Enable (WREN) and Write Disable (WRDI)	. 19
	6.4. Write STATUS Register (WRSR)	20
7.	Read Sequence	. 23
8.	Write Sequence	24
	8.1. Byte Write	24
	8.2. Page Write	24
	8.3. Polling Routine	25
9.	Packaging Information	. 26

9.1. Package Marking Information	26
10. Revision History	
The Microchip Website	
Product Change Notification Service	38
Customer Support	
Product Identification System	39
Microchip Devices Code Protection Feature	
Legal Notice	40
Trademarks	
Quality Management System	
Worldwide Sales and Service	42

# 1. Package Types (not to scale)

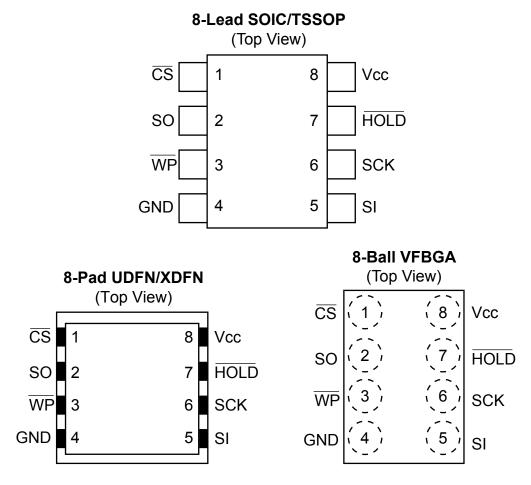

# 2. Pin Description

The descriptions of the pins are listed in Table 2-1.

#### Table 2-1. Pin Function Table

Name	8-Lead SOIC	8-Lead TSSOP	8-Pad UDFN <sup>(1)</sup>	8-Pad XDFN	8-Ball VFBGA	Function
CS	1	1	1	1	1	Chip Select
SO	2	2	2	2	2	Serial Data Output
WP <sup>(2)</sup>	3	3	3	3	3	Write-Protect
GND	4	4	4	4	4	Ground
SI	5	5	5	5	5	Serial Data Input
SCK	6	6	6	6	6	Serial Data Clock
HOLD <sup>(2)</sup>	7	7	7	7	7	Suspends Serial Input
Vcc	8	8	8	8	8	Device Power Supply

#### Note:

- 1. The exposed pad on this package can be connected to GND or left floating.
- 2. The Write-Protect (WP) and Hold (HOLD) pins should be driven high or low as appropriate.

## 2.1 Chip Select (CS)

The AT25080B/AT25160B is selected when the Chip Select ( $\overline{CS}$ ) pin is low. When the device is not selected, data will not be accepted via the Serial Data Input (SI) pin, and the Serial Output (SO) pin will remain in a high-impedance state.

To ensure robust operation, the  $\overline{CS}$  pin should follow V<sub>CC</sub> upon power-up. It is therefore recommended to connect  $\overline{CS}$  to V<sub>CC</sub> using a pull-up resistor (less than or equal to 10 k $\Omega$ ). After power-up, a low level on  $\overline{CS}$  is required prior to any sequence being initiated.

## 2.2 Serial Data Output (SO)

The Serial Data Output (SO) pin is used to transfer data out of the AT25080B/AT25160B. During a read sequence, data is shifted out on this pin after the falling edge of the Serial Data Clock (SCK).

## 2.3 Write-Protect (WP)

The Write-Protect ( $\overline{WP}$ ) pin will allow normal read/write operations when held high. When the  $\overline{WP}$  pin is brought low and the WPEN bit is set to a logic '1', all write operations to the STATUS register are inhibited.  $\overline{WP}$  going low while  $\overline{CS}$  is still low will interrupt a write operation to the STATUS register. If the internal write cycle has already been initiated,  $\overline{WP}$  going low will have no effect on any write operation to the STATUS register. The  $\overline{WP}$  pin function is blocked when the WPEN bit in the STATUS register is set to a logic '0'. This will allow the user to install the AT25080B/AT25160B in a system with the  $\overline{WP}$  pin tied to ground and still be able to write to the STATUS register. All  $\overline{WP}$  pin functions are enabled when the WPEN bit is set to a logic '1'.

## 2.4 Ground (GND)

The ground reference for the Device Power Supply ( $V_{CC}$ ). The Ground (GND) pin should be connected to the system ground.

## 2.5 Serial Data Input (SI)

The Serial Data Input (SI) pin is used to transfer data into the device. It receives instructions, addresses and data. Data is latched on the rising edge of the Serial Data Clock (SCK).

## 2.6 Serial Data Clock (SCK)

The Serial Data Clock (SCK) pin is used to synchronize the communication between a master and the AT25080B/ AT25160B. Instructions, addresses or data present on the Serial Data Input (SI) pin is latched in on the rising edge of SCK, while output on the Serial Data Output (SO) pin is clocked out on the falling edge of SCK.

# 2.7 Suspend Serial Input (HOLD)

The Suspend Serial Input ( $\overline{HOLD}$ ) pin is used in conjunction with the Chip Select ( $\overline{CS}$ ) pin to pause the AT25080B/ AT25160B. When the device is selected and a serial sequence is underway,  $\overline{HOLD}$  can be used to pause the serial communication with the master device without resetting the serial sequence. To pause, the  $\overline{HOLD}$  pin must be brought low while the Serial Data Clock (SCK) pin is low. To resume serial communication, the  $\overline{HOLD}$  pin is brought high while the SCK pin is low (SCK may still toggle during  $\overline{HOLD}$ ). Inputs to the Serial Data Input (SI) pin will be ignored while the Serial Data Output (SO) pin will be in the high-impedance state.


# 2.8 Device Power Supply (V<sub>CC</sub>)

The Device Power Supply ( $V_{CC}$ ) pin is used to supply the source voltage to the device. Operations at invalid  $V_{CC}$  voltages may produce spurious results and should not be attempted.

# 3. Description


The AT25080B/AT25160B provides 8,192/16,384 bits of Serial Electrically Erasable and Programmable Read-Only Memory (EEPROM) organized as 1,024/2,048 words of 8 bits each. The device is optimized for use in many industrial and commercial applications where low-power and low-voltage operation are essential. The device is available in space-saving 8-lead SOIC, 8-lead TSSOP, 8-pad UDFN, 8-pad XDFN and 8-ball VFBGA packages. All packages operate from 1.8V to 5.5V.

# 3.1 SPI Bus Master Connections to Serial EEPROMs

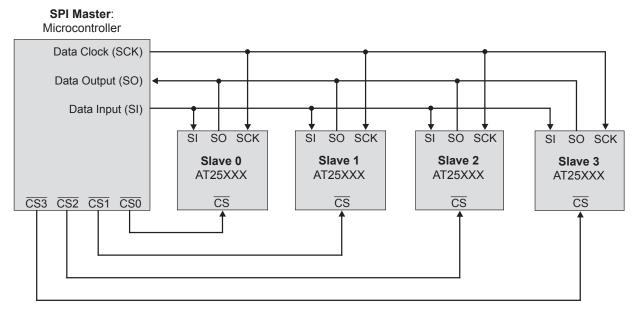

# AT25080B/AT25160B Description

# 3.2 Block Diagram

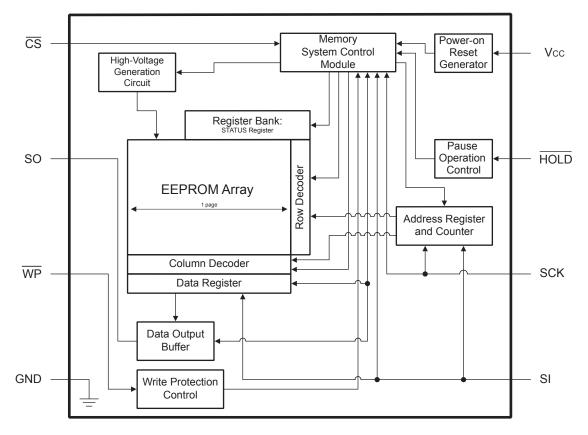

# 4. Electrical Characteristics

## 4.1 Absolute Maximum Ratings

Operating temperature	-55°C to +125°C
Storage temperature	-65°C to +150°C
Voltage on any pin with respect to ground	-1.0V to +7.0V
V <sub>cc</sub>	6.25V
DC output current	5.0 mA
ESD protection	> 2 kV

**Note:** Stresses above those listed under "Absolute Maximum Ratings" may cause permanent damage to the device. This is a stress rating only and functional operation of the device at these or any other conditions above those indicated in the operation listings of this specification is not implied. Exposure to absolute maximum rating conditions for extended periods may affect device reliability.

# 4.2 DC and AC Operating Range

### Table 4-1. DC and AC Operating Range

AT25080B/AT25160B		
Operating Temperature (Case)	Industrial Temperature Range	-40°C to +85°C
V <sub>CC</sub> Power Supply	Low-Voltage Grade	1.8V to 5.5V

## 4.3 DC Characteristics

## Table 4-2. DC Characteristics<sup>(1)</sup>

Parameter	Symbol	Minimum	Typical	Maximum	Units	Conditions
Supply Voltage	V <sub>CC1</sub>	1.8	_	5.5	V	
Supply Voltage	V <sub>CC2</sub>	2.5		5.5	V	
Supply Voltage	V <sub>CC3</sub>	4.5		5.5	V	
Supply Current	I <sub>CC1</sub>		7.5	10.0	mA	V <sub>CC</sub> = 5.0V at 20 MHz, SO = Open, Read
Supply Current	I <sub>CC2</sub>		4.0	10.0	mA	V <sub>CC</sub> = 5.0V at 20 MHz, SO = Open, Read, Write
Supply Current	I <sub>CC3</sub>		4.0	6.0	mA	V <sub>CC</sub> = 5.0V at 5 MHz, SO = Open, Read, Write
Standby Current	I <sub>SB1</sub>		<0.1	6.0 <sup>(3)</sup>	μA	$V_{CC}$ = 1.8V, $\overline{CS}$ = $V_{CC}$
Standby Current	I <sub>SB2</sub>		0.3	7.0 <sup>(3)</sup>	μA	$V_{CC}$ = 2.5V, $\overline{CS}$ = $V_{CC}$
Standby Current	I <sub>SB3</sub>	_	2.0	10.0 <sup>(3)</sup>	μA	$V_{CC}$ = 5.0V, $\overline{CS}$ = $V_{CC}$
Input Leakage	IIL	-3.0		3.0	μA	$V_{IN} = 0V$ to $V_{CC}$

## **Electrical Characteristics**

continued									
Parameter	Symbol	Minimum	Typical	Maximum	Units	Conditions			
Output Leakage	I <sub>OL</sub>	-3.0	—	3.0	μA	$V_{IN} = 0V$ to $V_{CC}$ , $T_A = 0^{\circ}C$ to +70°C			
Input Low-Voltage	V <sub>IL</sub> <sup>(2)</sup>	-0.6	—	V <sub>CC</sub> x 0.3	V				
Input High-Voltage	V <sub>IH</sub> <sup>(2)</sup>	V <sub>CC</sub> x 0.7	_	V <sub>CC</sub> + 0.5	V				
Output Low-Voltage	V <sub>OL1</sub>	_	_	0.4	V	$3.6 V \leq V_{CC} \leq 5.5 V$	I <sub>OL</sub> = 3.0 mA		
Output High-Voltage	V <sub>OH1</sub>	V <sub>CC</sub> - 0.8	_	_	V	$3.6 V \leq V_{CC} \leq 5.5 V$	I <sub>OH</sub> = -1.6 mA		
Output Low-Voltage	V <sub>OL2</sub>			0.2	V	1.8V ≤ V <sub>CC</sub> ≤ 3.6V	I <sub>OL</sub> = 0.15 mA		
Output High-Voltage	V <sub>OH2</sub>	V <sub>CC</sub> - 0.2			V	$1.8 V \leq V_{CC} \leq 3.6 V$	I <sub>OH</sub> = -100 μA		

#### Note:

- 1. Applicable over recommended operating range from:  $T_A = -40^{\circ}C$  to  $+85^{\circ}C$ ,  $V_{CC} = 1.8V$  to 5.5V (unless otherwise noted).
- 2.  $\ V_{IL}$  min and  $V_{IH}$  max are reference only and are not tested.
- 3. Worst-case measured at +85°C.

## 4.4 AC Characteristics

#### Table 4-3. AC Characteristics<sup>(1)</sup>

Parameter	Symbol	Minimum	Maximum	Units	Conditions
SCK Clock Frequency	f <sub>SCK</sub>	0	20	MHz	V <sub>CC</sub> = 4.5V to 5.5V
		0	10	MHz	V <sub>CC</sub> = 2.5V to 5.5V
		0	5	MHz	V <sub>CC</sub> = 1.8V to 5.5V
Input Rise Time	t <sub>RI</sub>	_	2000	ns	V <sub>CC</sub> = 4.5V to 5.5V
		_	2000	ns	V <sub>CC</sub> = 2.5V to 5.5V
		_	2000	ns	V <sub>CC</sub> = 1.8V to 5.5V
Input Fall Time	t <sub>FI</sub>	_	2000	ns	$V_{CC}$ = 4.5V to 5.5V
		_	2000	ns	V <sub>CC</sub> = 2.5V to 5.5V
		_	2000	ns	V <sub>CC</sub> = 1.8V to 5.5V
SCK High Time	t <sub>WH</sub>	20	—	ns	$V_{CC}$ = 4.5V to 5.5V
		40		ns	$V_{CC}$ = 2.5V to 5.5V
		80		ns	$V_{CC}$ = 1.8V to 5.5V

# **Electrical Characteristics**

continued									
Parameter	Symbol	Minimum	Maximum	Units	Conditions				
SCK Low Time	t <sub>WL</sub>	20	—	ns	$V_{CC}$ = 4.5V to 5.5V				
		40	—	ns	$V_{CC}$ = 2.5V to 5.5V				
		80		ns	$V_{CC}$ = 1.8V to 5.5V				
CS High Time	t <sub>CS</sub>	25	—	ns	$V_{CC}$ = 4.5V to 5.5V				
		50	—	ns	$V_{CC}$ = 2.5V to 5.5V				
		100	—	ns	V <sub>CC</sub> = 1.8V to 5.5V				
CS Setup Time	t <sub>CSS</sub>	25	—	ns	$V_{CC}$ = 4.5V to 5.5V				
		50	—	ns	$V_{CC}$ = 2.5V to 5.5V				
		100	—	ns	V <sub>CC</sub> = 1.8V to 5.5V				
CS Hold Time	t <sub>CSH</sub>	25	_	ns	V <sub>CC</sub> = 4.5V to 5.5V				
		50	—	ns	$V_{CC}$ = 2.5V to 5.5V				
		100	—	ns	V <sub>CC</sub> = 1.8V to 5.5V				
Data In Setup Time	t <sub>SU</sub>	5	_	ns	V <sub>CC</sub> = 4.5V to 5.5V				
		10	_	ns	$V_{CC}$ = 2.5V to 5.5V				
		20	—	ns	V <sub>CC</sub> = 1.8V to 5.5V				
Data In Hold Time	t <sub>H</sub>	5	—	ns	$V_{CC}$ = 4.5V to 5.5V				
		10	—	ns	$V_{CC}$ = 2.5V to 5.5V				
		20	—	ns	V <sub>CC</sub> = 1.8V to 5.5V				
HOLD Setup Time	t <sub>HD</sub>	5	_	ns	V <sub>CC</sub> = 4.5V to 5.5V				
		10	_	ns	$V_{CC}$ = 2.5V to 5.5V				
		20	_	ns	V <sub>CC</sub> = 1.8V to 5.5V				
HOLD Hold Time	t <sub>CD</sub>	5	_	ns	V <sub>CC</sub> = 4.5V to 5.5V				
		10	_	ns	$V_{CC}$ = 2.5V to 5.5V				
		20	_	ns	V <sub>CC</sub> = 1.8V to 5.5V				
Output Valid	t <sub>V</sub>	0	20	ns	$V_{CC}$ = 4.5V to 5.5V				
		0	40	ns	$V_{CC}$ = 2.5V to 5.5V				
		0	80	ns	V <sub>CC</sub> = 1.8V to 5.5V				
Output Hold Time	t <sub>HO</sub>	0	_	ns	V <sub>CC</sub> = 4.5V to 5.5V				
		0	_	ns	$V_{CC}$ = 2.5V to 5.5V				
		0	_	ns	V <sub>CC</sub> = 1.8V to 5.5V				
HOLD to Output Low Z	t <sub>LZ</sub>	0	25	ns	V <sub>CC</sub> = 4.5V to 5.5V				
		0	50	ns	V <sub>CC</sub> = 2.5V to 5.5V				
		0	100	ns	V <sub>CC</sub> = 1.8V to 5.5V				


## **Electrical Characteristics**

continued									
Parameter	Symbol	Minimum	Maximum	Units	Conditions				
HOLD to Output High Z	t <sub>HZ</sub>	—	40	ns	$V_{CC}$ = 4.5V to 5.5V				
			80	ns	$V_{CC}$ = 2.5V to 5.5V				
		_	200	ns	V <sub>CC</sub> = 1.8V to 5.5V				
Output Disable Time	t <sub>DIS</sub>		40	ns	$V_{CC}$ = 4.5V to 5.5V				
			80	ns	$V_{CC}$ = 2.5V to 5.5V				
			200	ns	V <sub>CC</sub> = 1.8V to 5.5V				
Write Cycle Time	t <sub>WC</sub>		5	ms	$V_{CC}$ = 4.5V to 5.5V				
			5	ms	V <sub>CC</sub> = 2.5V to 5.5V				
			5	ms	V <sub>CC</sub> = 1.8V to 5.5V				

Note:

1. Applicable over recommended operating range from  $T_A = -40^{\circ}C$  to  $+85^{\circ}C$ ,  $V_{CC} = As$  Specified,  $C_L = 1$  TTL Gate and 30 pF (unless otherwise noted).

## 4.5 SPI Synchronous Data Timimg

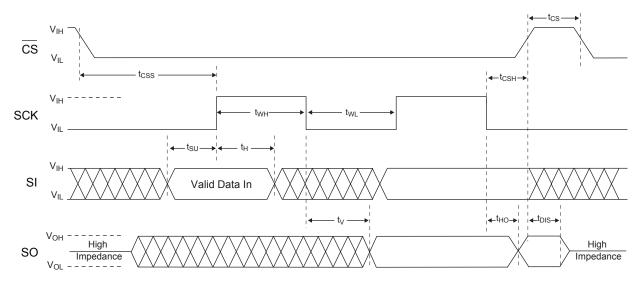

## 4.6 Electrical Specifications

#### 4.6.1 Power-Up Requirements and Reset Behavior

During a power-up sequence, the V<sub>CC</sub> supplied to the AT25080B/AT25160B should monotonically rise from GND to the minimum V<sub>CC</sub> level, as specified in Table 4-1, with a slew rate no faster than 0.1 V/ $\mu$ s.

#### 4.6.1.1 Device Reset

To prevent inadvertent write operations or any other spurious events from occurring during a power-up sequence, the AT25080B/AT25160B includes a Power-on Reset (POR) circuit. Upon power-up, the device will not respond to any instructions until the  $V_{CC}$  level crosses the internal voltage threshold ( $V_{POR}$ ) that brings the device out of Reset and into Standby mode.

## **Electrical Characteristics**

The system designer must ensure the instructions are not sent to the device until the  $V_{CC}$  supply has reached a stable value greater than or equal to the minimum  $V_{CC}$  level. Additionally, once the  $V_{CC}$  is greater than or equal to the minimum  $V_{CC}$  level, the bus master must wait at least  $t_{PUP}$  before sending the first instruction to the device. See Table 4-4 for the values associated with these power-up parameters.

#### Table 4-4. Power-Up Conditions<sup>(1)</sup>

Symbol	Parameter	Min.	Max.	Units
t <sub>PUP</sub>	Time required after $V_{CC}$ is stable before the device can accept instructions	100	_	μs
V <sub>POR</sub>	Power-on Reset Threshold Voltage	_	1.5	V
t <sub>POFF</sub>	Minimum time at $V_{CC}$ = 0V between power cycles	0.03	—	ms

#### Note:

1. These parameters are characterized but they are not 100% tested in production.

If an event occurs in the system where the  $V_{CC}$  level supplied to the AT25080B/AT25160B drops below the maximum  $V_{POR}$  level specified, it is recommended that a full-power cycle sequence be performed by first driving the  $V_{CC}$  pin to GND in less than 1 ms, waiting at least the minimum  $t_{POFF}$  time and then performing a new power-up sequence in compliance with the requirements defined in this section.

#### 4.6.2 Pin Capacitance

#### Table 4-5. Pin Capacitance<sup>(1,2)</sup>

Symbol	Test Condition	Max.	Units	Conditions
C <sub>OUT</sub>	Output Capacitance (SO)	8	pF	V <sub>OUT</sub> = 0V
C <sub>IN</sub>	Input Capacitance (CS, SCK, SI, WP, HOLD)	6	pF	V <sub>IN</sub> = 0V

#### Note:

- 1. This parameter is characterized but is not 100% tested in production.
- 2. Applicable over recommended operating range from:  $T_A = 25^{\circ}C$ ,  $f_{SCK} = 1.0$  MHz,  $V_{CC} = 5.0V$  (unless otherwise noted).

#### 4.6.3 EEPROM Cell Performance Characteristics

#### Table 4-6. EEPROM Cell Performance Characteristics

Operation	Test Condition	Min.	Max.	Units
Write Endurance <sup>(1)</sup>	$T_A = 25^{\circ}C$ , $V_{CC} = 3.3V$ , Page Write mode	1,000,000	—	Write Cycles
Data Retention <sup>(1)</sup>	T <sub>A</sub> = 55°C	100	_	Years

#### Note:

1. Performance is determined through characterization and the qualification process.

#### 4.6.4 Software Reset

The SPI interface of the AT25080B/AT25160B can be reset by toggling the  $\overline{CS}$  input. If the  $\overline{CS}$  line is already in the active state, it must complete a transition from the inactive state ( $\geq V_{IH}$ ) to the active state ( $\leq V_{IL}$ ) and then back to the inactive state ( $\geq V_{IH}$ ) without sending clocks on the SCK line. Upon completion of this sequence, the device will be ready to receive a new opcode on the SI line.

#### 4.6.5 Device Default State at Power-Up

The AT25080B/AT25160B default state upon power-up consists of:

Standby Power mode

## **Electrical Characteristics**

- A high-to-low-level transition on  $\overline{CS}$  is required to enter active state
- Write Enable Latch (WEL) bit in the STATUS register = 0
- Ready/Busy bit in the STATUS register = 0, indicating the device is ready to accept a new command
- Device is not selected
- Not in Hold condition
- WPEN, BP1 and BP0 bits in the STATUS register are unchanged from their previous state due to the fact that they are nonvolatile values


#### 4.6.6 Device Default Condition

The AT25080B/AT25160B is shipped from Microchip to the customer with the EEPROM array set to an all FFh data pattern (logic '1' state). The Write-Protect Enable bit in the STATUS register is set to logic '0' and the Block Write-Protection bits in the STATUS register are set to logic '0'.

# 5. Device Operation

The AT25080B/AT25160B is controlled by a set of instructions that are sent from a host controller, commonly referred to as the SPI Master. The SPI Master communicates with the AT25080B/AT25160B via the SPI bus which is comprised of four signal lines: Chip Select ( $\overline{CS}$ ), Serial Data Clock (SCK), Serial Data Input (SI) and Serial Data Output (SO).

The SPI protocol defines a total of four modes of operation (Mode 0, 1, 2 or 3) with each mode differing in respect to the SCK polarity and phase and how the polarity and phase control the flow of data on the SPI bus. The AT25080B/ AT25160B supports the two most common modes, SPI Modes 0 and 3. With SPI Modes 0 and 3, data is always latched in on the rising edge of SCK and always output on the falling edge of SCK. The only difference between SPI Modes 0 and 3 is the polarity of the SCK signal when in the inactive state (when the SPI Master is in Standby mode and not transferring any data). SPI Mode 0 is defined as a low SCK while  $\overline{CS}$  is not asserted (at  $V_{CC}$ ) and SPI Mode 3 has SCK high in the inactive state. The SCK Idle state must match when the  $\overline{CS}$  is deasserted both before and after the communication sequence in SPI Mode 0 and 3. The figures in this document depict Mode 0 with a solid line on SCK while  $\overline{CS}$  is inactive and Mode 3 with a dotted line.

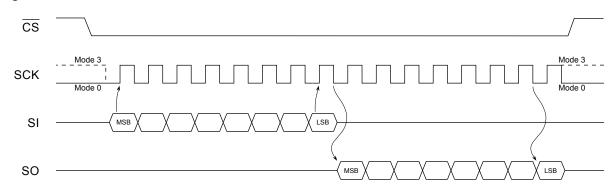

#### Figure 5-1. SPI Mode 0 and Mode 3

## 5.1 Interfacing the AT25080B/AT25160B on the SPI Bus

Communication to and from the AT25080B/AT25160B must be initiated by the SPI Master device, such as a microcontroller. The SPI Master device must generate the serial clock for the AT25080B/AT25160B on the Serial Data Clock (SCK) pin. The AT25080B/AT25160B always operates as a slave due to the fact that the SCK is always an input.

#### 5.1.1 Selecting the Device

The AT25080B/AT25160B is selected when the Chip Select ( $\overline{CS}$ ) pin is low. When the device is not selected, data will not be accepted via the Serial Data Input (SI) pin, and the Serial Data Output (SO) pin will remain in a high-impedance state.

#### 5.1.2 Sending Data to the Device

The AT25080B/AT25160B uses the SI pin to receive information. All instructions, addresses and data input bytes are clocked into the device with the Most Significant bit (MSb) first. The SI pin samples on the first rising edge of the SCK line after the  $\overline{CS}$  has been asserted.

#### 5.1.3 Receiving Data from the Device

Data output from the device is transmitted on the SO pin, with the MSb output first. The SO data is latched on the first falling edge of SCK after the instruction has been clocked into the device, such as the Read from Memory Array (READ) and Read STATUS Register (RDSR) instructions. See Read Sequence for more details.

#### 5.2 Device Opcodes

#### 5.2.1 Serial Opcode

After the device is selected by driving  $\overline{CS}$  low, the first byte will be received on the SI pin. This byte contains the opcode that defines the operation to be performed. Refer to Table 6-1 for a list of all opcodes that the AT25080B/ AT25160B will respond to.

#### 5.2.2 Invalid Opcode

If an invalid opcode is received, no data will be shifted into AT25080B/AT25160B and the SO pin will remain in a high-impedance state until the falling edge of  $\overline{CS}$  is detected again. This will reinitialize the serial communication.

## 5.3 Hold Function


The Suspend Serial Input (HOLD) pin is used to pause the serial communication with the device without having to stop or reset the clock sequence. The Hold mode, however, does not have an effect on the internal write cycle. Therefore, if a write cycle is in progress, asserting the HOLD pin will not pause the operation and the write cycle will continue to completion.

The Hold mode can only be entered while the  $\overline{CS}$  pin is asserted. The Hold mode is activated by asserting the  $\overline{HOLD}$  pin during the SCK low pulse. If the  $\overline{HOLD}$  pin is asserted during the SCK high pulse, then the Hold mode will not be started until the beginning of the next SCK low pulse. The device will remain in the Hold mode as long as the  $\overline{HOLD}$  pin and  $\overline{CS}$  pin are asserted.

While in Hold mode, the SO pin will be in a high-impedance state. In addition, both the SI pin and the SCK pin will be ignored. The Write-Protect (WP) pin, however, can still be asserted or deasserted while in the Hold mode.

To end the Hold mode and resume serial communication, the  $\overline{HOLD}$  pin must be deasserted during the SCK low pulse. If the  $\overline{HOLD}$  pin is deasserted during the SCK high pulse, then the Hold mode will not end until the beginning of the next SCK low pulse.


If the  $\overline{CS}$  pin is deasserted while the  $\overline{HOLD}$  pin is still asserted, then any operation that may have been started will be aborted and the device will reset the WEL bit in the STATUS register back to the logic '0' state.

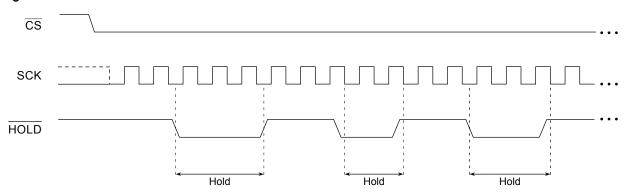

#### Figure 5-2. Hold Mode

## **Device Operation**

#### Figure 5-3. Hold Timing

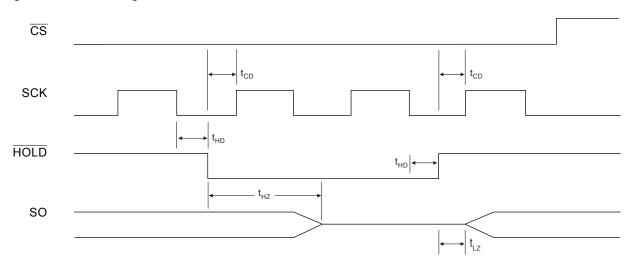

## 5.4 Write Protection

The Write-Protect ( $\overline{WP}$ ) pin will allow normal read and write operations when held high. When the  $\overline{WP}$  pin is brought low and WPEN bit is a logic '1', all write operations to the STATUS register are inhibited. The  $\overline{WP}$  pin going low while  $\overline{CS}$  is still low will interrupt a Write STATUS Register (WRSR). If the internal write cycle has already been initiated,  $\overline{WP}$ going low will have no effect on any write operation to the STATUS register. The  $\overline{WP}$  pin function is blocked when the WPEN bit in the STATUS register is a logic '0'. This will allow the user to install the AT25080B/AT25160B device in a system with the  $\overline{WP}$  pin tied to ground and still be able to write to the STATUS register. All  $\overline{WP}$  pin functions are enabled when the WPEN bit is set to a logic '1'.

# 6. Device Commands and Addressing

The AT25080B/AT25160B is designed to interface directly with the synchronous Serial Peripheral Interface (SPI). The AT25080B/AT25160B utilizes an 8-bit instruction register. The list of instructions and their operation codes are contained in Table 6-1. All instructions, addresses and data are transferred with the MSb first and start with a high-to-low  $\overline{CS}$  transition.

Instruction Name	Instruction Format	Operates On	Operation Description
WREN	0000 X110	STATUS Register	Set Write Enable Latch (WEL)
WRDI	0000 X100	STATUS Register	Reset Write Enable Latch (WEL)
RDSR	0000 X101	STATUS Register	Read STATUS Register
WRSR	0000 X001	STATUS Register	Write STATUS Register
READ	0000 X011	Memory Array	Read from Memory Array
WRITE	0000 X010	Memory Array	Write to Memory Array

Table 6-1. Instruction Set for the AT25080B/AT25160B

# 6.1 STATUS Register Bit Definition and Function

The AT25080B/AT25160B includes an 8-bit STATUS register. The STATUS register bits modulate various features of the device as shown in Table 6-2 and Table 6-3. These bits can be changed by specific instructions that are detailed in the following sections.

#### Table 6-2. STATUS Register Format

Bit 7	Bit 6	Bit 5	Bit 4	Bit 3	Bit 2	Bit 1	Bit 0
WPEN	Х	Х	Х	BP1	BP0	WEL	RDY/BSY

#### Table 6-3. STATUS Register Bit Definition


Bit		Name	Туре		Description					
7	WPEN	Write-Protect Enable	R/W	0	See Table 6-5 (Factory Default)					
				1	See Table 6-5 (Factory Default)					
6:4	RFU	Reserved for Future Use	R	0	Reads as zeros when the device is not in a write cycle					
				1	Reads as ones when the device is in a write cycle					
3:2	BP1	Block Write Protection	R/W	00	No array write protection (Factory Default)					
	BP0	ВРО	BFU		20	BP0	0		01	Quarter array write protection (see Table 6-4)
				10	Half array write protection (see Table 6-4)					
				11	Entire array write protection (see Table 6-4)					
1	WEL	Write Enable Latch	R	0	Device is not write enabled (Power-up Default)					
				1	Device is write enabled					
0	RDY/BSY	Ready/Busy Status	R	0	Device is ready for a new sequence					
				1	Device is busy with an internal operation					

© 2019 Microchip Technology Inc.

## 6.2 Read STATUS Register (RDSR)

The Read STATUS Register (RDSR) instruction provides access to the STATUS register. The ready/busy and write enable status of the device can be determined by the RDSR instruction. Similarly, the Block Write Protection (BP1, BP0) bits indicate the extent of memory array protection employed. The STATUS register is read by asserting the  $\overline{CS}$  pin, followed by sending in a 05h opcode on the SI pin. Upon completion of the opcode, the device will return the 8-bit STATUS register value on the SO pin.

#### Figure 6-1. RDSR Waveform

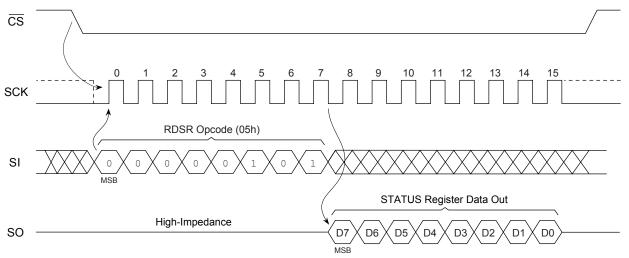


## 6.3 Write Enable (WREN) and Write Disable (WRDI)

Enabling and disabling writing to the STATUS register and EEPROM array is accomplished through the Write Enable (WREN) instruction and the Write Disable (WRDI) instruction. These functions change the status of the WEL bit in the STATUS register.

#### 6.3.1 Write Enable Instruction (WREN)

The Write Enable Latch (WEL) bit of the STATUS register must be set to a logic '1' prior to each Write STATUS Register (WRSR) and Write to Memory Array (WRITE) instructions. This is accomplished by sending a WREN (06h) instruction to the AT25080B/AT25160B. First, the  $\overline{CS}$  pin is driven low to select the device and then a WREN instruction is clocked in on the SI pin. Then the  $\overline{CS}$  pin can be driven high and the WEL bit will be updated in the STATUS register to a logic '1'. The device will power-up in the Write Disable state (WEL = 0).

## **Device Commands and Addressing**

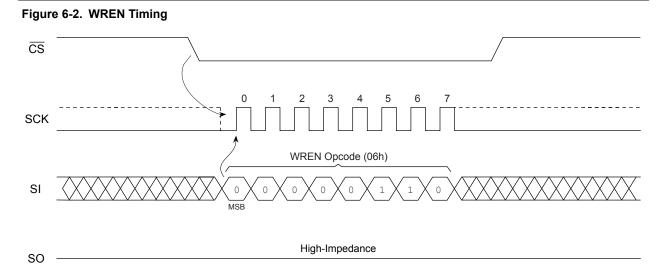

#### 6.3.2 Write Disable Instruction (WRDI)

To protect the device against inadvertent writes, the Write Disable (WRDI) instruction (opcode 04h) disables all programming modes by setting the WEL bit to a logic '0'. The WRDI instruction is independent of the status of the WP pin.

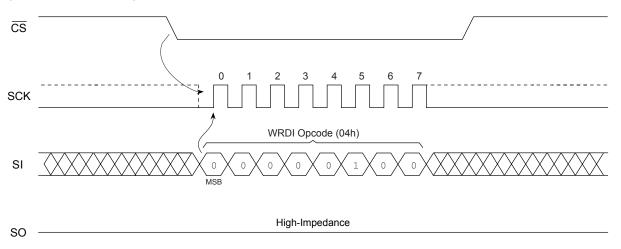


Figure 6-3. WRDI Timing


## 6.4 Write STATUS Register (WRSR)

The Write STATUS Register (WRSR) instruction enables the SPI Master to change selected bits of the STATUS register. Before a WRSR instruction can be initiated, a WREN instruction must be executed to set the WEL bit to logic '1'. Upon completion of a WREN instruction, a WRSR instruction can be executed.

**Note:** The WRSR instruction has no effect on bit 6, bit 5, bit 4, bit 1 and bit 0 of the STATUS register. Only bit 7, bit 3 and bit 2 can be changed via the WRSR instruction. These modifiable bits are the Write-Protect Enable (WPEN) and Block Protect (BP1, BP0) bits. These three bits are nonvolatile bits that have the same properties and functions as regular EEPROM cells. Their values are retained while power is removed from the device.

The AT25080B/AT25160B will not respond to commands other than a RDSR after a WRSR instruction until the self-timed internal write cycle has completed. When the write cycle is completed, the WEL bit in the STATUS register is reset to logic '0'.

#### Figure 6-4. WRSR Waveform

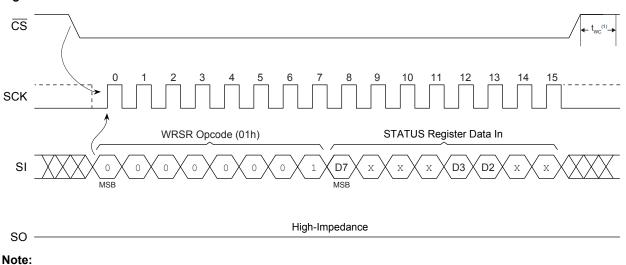

#### 1. This instruction initiates a self-timed internal write cycle (t<sub>WC</sub>) on the rising edge of CS after a valid sequence.

#### 6.4.1 Block Write-Protect Function

The WRSR instruction allows the user to select one of four possible combinations as to how the memory array will be inhibited from writing through changing the Block Write-Protect bits (BP1, BP0). The four levels of array protection are:

- None of the memory array is protected.
- Upper quarter (1/4) address range is write-protected meaning the highest order address bits are read-only.
- Upper half (1/2) address range is write-protected meaning the highest order address bits are read-only.
- All of the memory array is write-protected meaning all address bits are read-only.

The Block Write Protection levels and corresponding STATUS register control bits are shown in Table 6-4.

Level	STATUS Re	egister Bits	Write-Protected/Read	-Only Address Range
	BP1	BP0	AT25080B	AT25160B
0	0	0	None	None
1(1/4)	0	1	0300h-03FFh	0600h-07FFh
2(1/2)	1	0	0200h-03FFh	0400h-07FFh
3(All)	1	1	0000h-03FFh	0000h-07FFh

#### Table 6-4. Block Write-Protect Bits

#### 6.4.2 Write-Protect Enable Function

The WRSR instruction also allows the user to enable or disable the Write-Protect ( $\overline{WP}$ ) pin through the use of the Write-Protect Enable (WPEN) bit. When the WPEN bit is set to logic '0', the ability to write the EEPROM array is dictated by the values of the Block Write-Protect (BP1, BP0) bits. The ability to write the STATUS register is controlled by the WEL bit. When the WPEN bit is set to logic '1', the STATUS register is read-only.

Hardware Write Protection is enabled when both the  $\overline{WP}$  pin is low and the WPEN bit has been set to a logic '1'. When the device is Hardware Write-Protected, writes to the STATUS register, including the Block Write-Protect, WEL and WPEN bits and to the sections in the memory array selected by the Block Write-Protect bits are disabled. When Hardware Write Protection is enabled, writes are only allowed to sections of the memory that are not block-protected.

# **Device Commands and Addressing**

Hardware Write Protection is disabled when either the  $\overline{WP}$  pin is high or the WPEN bit is a logic '0'. When Hardware Write Protection is disabled, writes are only allowed to sections of the memory that are not block-protected. Refer to Table 6-5 for additional information.

**Note:** When the WPEN bit is Hardware Write-Protected, it cannot be set back to a logic '0' as long as the  $\overline{WP}$  pin is held low.

WPEN	WP Pin	WEL	Protected Blocks	Unprotected Blocks	STATUS Register
0	х	0	Protected	Protected	Protected
0	x	1	Protected	Writable	Writable
1	Low	0	Protected	Protected	Protected
1	Low	1	Protected	Writable	Protected
x	High	0	Protected	Protected	Protected
x	High	1	Protected	Writable	Writable

#### Table 6-5. WPEN Operation

# 7. Read Sequence


Reading the AT25080B/AT25160B via the SO pin requires the following sequence. After the  $\overline{CS}$  line is pulled low to select a device, the READ (03h) instruction is transmitted via the SI line followed by the 16-bit address to be read. Refer to Table 7-1 for the address bits for AT25080B/AT25160B.

#### Table 7-1. AT25080B/AT25160B Address Bits

Address	AT25080B	AT25160B
A <sub>N</sub>	A <sub>9</sub> —A <sub>0</sub>	A <sub>10</sub> —A <sub>0</sub>
Don't Care Bits	A <sub>15</sub> —A <sub>10</sub>	A <sub>15</sub> —A <sub>11</sub>

Upon completion of the 16-bit address, any data on the SI line will be ignored. The data (D7-D0) at the specified address is then shifted out onto the SO line. If only one byte is to be read, the  $\overline{CS}$  line should be driven high after the data comes out. The read sequence can be continued since the byte address is automatically incremented and data will continue to be shifted out. When the highest-order address bit is reached, the address counter will rollover to the lowest-order address bit allowing the entire memory to be read in one continuous read cycle regardless of the starting address.



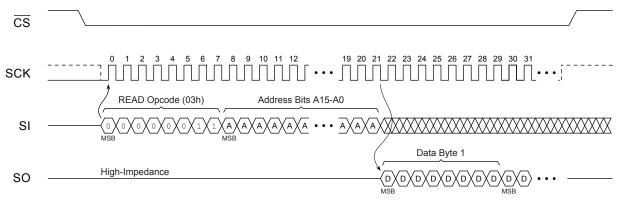

# 8. Write Sequence

In order to program the AT25080B/AT25160B, two separate instructions must be executed. First, the device *must be write enabled* via the Write Enable (WREN) instruction. Then, one of the two possible write sequences described in this section may be executed.

**Note:** If the device is not Write Enabled (WREN), the device will ignore the WRITE instruction and will return to the standby state when  $\overline{CS}$  is brought high. A new  $\overline{CS}$  assertion is required to re-initiate communication.


The address of the memory location(s) to be programmed must be outside the protected address field location selected by the block write protection level. During an internal write cycle, all commands will be ignored except the RDSR instruction. Refer to Table 8-1 for the address bits for AT25080B/AT25160B.

#### Table 8-1. AT25080B/AT25160B Address Bits

Address	AT25080B	AT25160B
A <sub>N</sub>	A9—A0	A <sub>10</sub> —A <sub>0</sub>
Don't Care Bits	A <sub>15</sub> —A <sub>10</sub>	A <sub>15</sub> —A <sub>11</sub>

## 8.1 Byte Write

A byte write requires the following sequence and is depicted in Figure 8-1. After the  $\overline{CS}$  line is pulled low to select the device, the WRITE (02h) instruction is transmitted via the SI line followed by the 16-bit address and the data (D7-D0) to be programmed. Programming will start after the  $\overline{CS}$  pin is brought high. The low-to-high transition of the  $\overline{CS}$  pin must occur during the SCK low time (Mode 0) and SCK high time (Mode 3) immediately after clocking in the D0 (LSB) data bit. The AT25080B/AT25160B is automatically returned to the Write Disable state (STATUS register bit WEL = 0) at the completion of a write cycle.

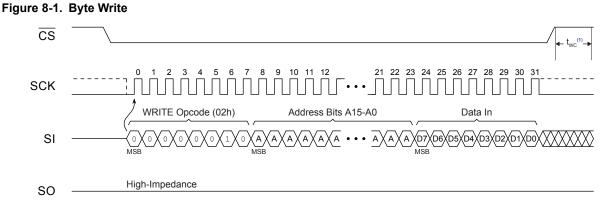

#### Note:

1. This instruction initiates a self-timed internal write cycle ( $t_{WC}$ ) on the rising edge of  $\overline{CS}$  after a valid sequence.

## 8.2 Page Write

A page write sequence allows up to 32 bytes to be written in the same write cycle, provided that all bytes are in the same row of the memory array. Partial page writes of less than 32 bytes are allowed. After each byte of data is received, the five lowest order address bits are internally incremented following the receipt of each data byte. The higher order address bits are not incremented and retain the memory array page location. If more bytes of data are transmitted that what will fit to the end of that memory row, the address counter will rollover to the beginning of the same row. Nevertheless, creating a rollover event should be avoided as previously loaded data in the page could become unintentionally altered. The AT25080B/AT25160B is automatically returned to the Write Disable state (WEL = 0) at the completion of a write cycle.

#### Figure 8-2. Page Write CS SCK ••• WRITE Opcode (02h) Data In Byte 1 Address Bits A15-A0 Data In Byte 32 SI 0 A A) <σχοχοχοχοχοχοχογο ʹϲϪϲϪϲϪϲϪϲϪϲ σ` 0 0 High-Impedance SO

#### Note:


1. This instruction initiates a self-timed internal write cycle ( $t_{WC}$ ) on the rising edge of  $\overline{CS}$  after a valid sequence.

## 8.3 Polling Routine

A polling routine can be implemented to optimize time-sensitive applications that would not prefer to wait the fixed maximum write cycle time ( $t_{WC}$ ). This method allows the application to know immediately when the write cycle has completed to start a subsequent operation.

Once the internally-timed write cycle has started, a polling routine can be initiated. This involves repeatedly sending Read STATUS Register (RDSR) instruction to determine if the device has completed its self-timed internal write cycle. If the  $\overline{RDY}/BSY$  bit (bit 0 of STATUS register) = 1, the write cycle is still in progress. If bit 0 = 0, the write cycle has ended. If the  $\overline{RDY}/BSY$  bit = 1, repeated RDSR commands can be executed until the  $\overline{RDY}/BSY$  bit = 0, signaling that the device is ready to execute a new instruction. Only the Read STATUS Register (RDSR) instruction is enabled during the write cycle.

#### Figure 8-3. Polling Flowchart

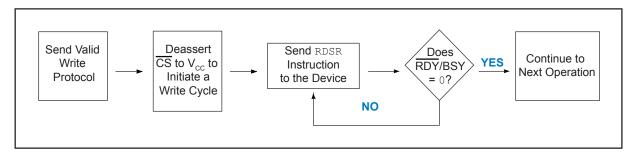


# 9. Packaging Information

# 9.1 Package Marking Information

	8-lead	d SOIC	8-lead TSSOP	8-pad	UDFN
		ATMLHYWW ###% CO YYWNNN ●	ATHYWW ###%CO YYWWNNN	2.0 x 3.0	mm Body ### H% NNN •
	8-pad	I XDFN	8-ball VFBGA		
	1.8 x 2.2	2 mm Body	1.5 x 2.0 mm Body		
		### NNN ●	###U ₩NNN ●		
atalog Numbe T25080B T25160B Date Codes		ige drawings are not to scale	Truncation Code ###: 58B Truncation Code ###: 5AB		Voltages
'Y = Year		Y = Year	WW = Work Week o	of Assembly	% = Minimum Voltage
	: 2020 : 2021 : 2022 : 2023	6: 2016         0: 20           7: 2017         1: 20           8: 2018         2: 20           9: 2019         3: 20	021 04: Week 4 022		L: 1.8V min
8: 2018 22					Atmel Truncation
8: 2018 22 9: 2019 23	in	D	evice Grade		
8: 2018 22			l or U: Industrial Grade		AT: Atmel ATM: Atmel ATML: Atmel
8: 2018 22 9: 2019 23 ountry of Orig	Origin	Н			ATM: Atmel

# **Packaging Information**

# 8-Lead Plastic Small Outline (SN) - Narrow, 3.90 mm (.150 In.) Body [SOIC]

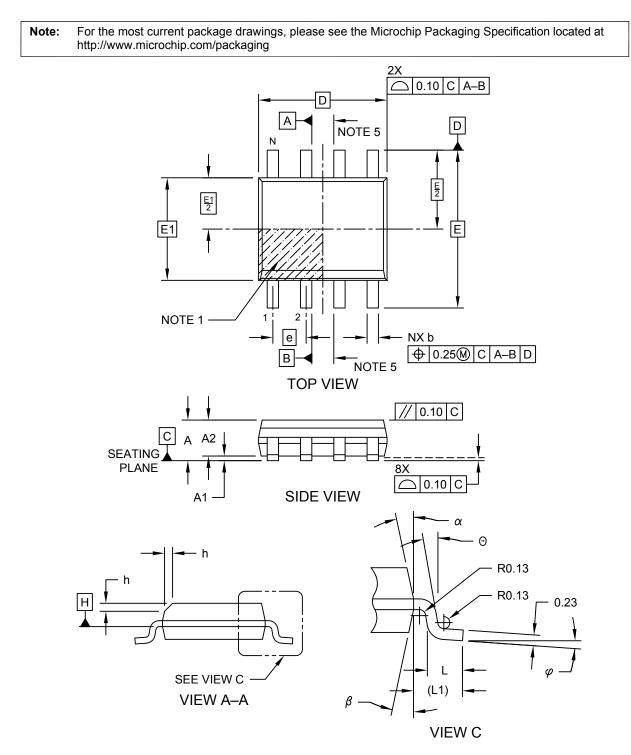


Microchip Technology Drawing No. C04-057-SN Rev E Sheet 1 of 2

## **Packaging Information**

#### 8-Lead Plastic Small Outline (SN) - Narrow, 3.90 mm (.150 In.) Body [SOIC]

**Note:** For the most current package drawings, please see the Microchip Packaging Specification located at http://www.microchip.com/packaging

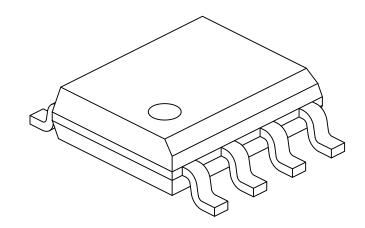

	Units	MILLIMETERS			
Dimensio	on Limits	MIN	NOM	MAX	
Number of Pins	Ν	8			
Pitch	е	1.27 BSC			
Overall Height	Α	-	-	1.75	
Molded Package Thickness	A2	1.25	-	-	
Standoff §	A1	0.10	-	0.25	
Overall Width	E	6.00 BSC			
Molded Package Width	E1	3.90 BSC			
Overall Length	D	4.90 BSC			
Chamfer (Optional)	h	0.25	-	0.50	
Foot Length	L	0.40	-	1.27	
Footprint	L1	1.04 REF			
Foot Angle	φ	0°	-	8°	
Lead Thickness	С	0.17	-	0.25	
Lead Width	b	0.31	-	0.51	
Mold Draft Angle Top	α	5°	-	15°	
Mold Draft Angle Bottom	β	5°	-	15°	

Notes:

1. Pin 1 visual index feature may vary, but must be located within the hatched area.

2. § Significant Characteristic


- 3. Dimensions D and E1 do not include mold flash or protrusions. Mold flash or protrusions shall not exceed 0.15mm per side.
- 4. Dimensioning and tolerancing per ASME Y14.5M
  - BSC: Basic Dimension. Theoretically exact value shown without tolerances.
  - REF: Reference Dimension, usually without tolerance, for information purposes only.
- 5. Datums A & B to be determined at Datum H.

Microchip Technology Drawing No. C04-057-SN Rev E Sheet 2 of 2

# **Packaging Information**

## 8-Lead Plastic Small Outline (SN) - Narrow, 3.90 mm Body [SOIC]

**Note:** For the most current package drawings, please see the Microchip Packaging Specification located at http://www.microchip.com/packaging

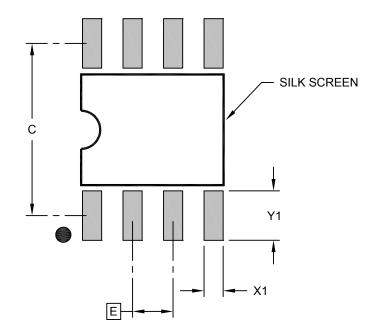

## RECOMMENDED LAND PATTERN

	MILLIMETERS			
Dimension	MIN	NOM	MAX	
Contact Pitch	E		1.27 BSC	
Contact Pad Spacing	С		5.40	
Contact Pad Width (X8)	X1			0.60
Contact Pad Length (X8)	Y1			1.55

Notes:

1. Dimensioning and tolerancing per ASME Y14.5M


BSC: Basic Dimension. Theoretically exact value shown without tolerances.

Microchip Technology Drawing C04-2057-SN Rev E

## **Packaging Information**

#### 8-Lead Plastic Thin Shrink Small Outline (ST) – 4.4 mm Body [TSSOP]

**Note:** For the most current package drawings, please see the Microchip Packaging Specification located at http://www.microchip.com/packaging

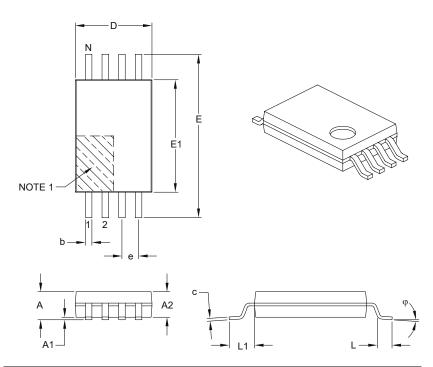

	Units	MILLIMETERS			
D	imension Limits	MIN	NOM	MAX	
Number of Pins		8			
Pitch	е	0.65 BSC			
Overall Height	A	-	-	1.20	
Molded Package Thickness	A2	0.80	1.00	1.05	
Standoff	A1	0.05	-	0.15	
Overall Width	E		6.40 BSC		
Molded Package Width	E1	4.30	4.40	4.50	
Molded Package Length	D	2.90	3.00	3.10	
Foot Length	L	0.45	0.60	0.75	
Footprint	L1		1.00 REF		
Foot Angle	φ	0°	-	8°	
Lead Thickness	С	0.09	-	0.20	
Lead Width	b	0.19	-	0.30	

Notes:

1. Pin 1 visual index feature may vary, but must be located within the hatched area.

2. Dimensions D and E1 do not include mold flash or protrusions. Mold flash or protrusions shall not exceed 0.15 mm per side.

3. Dimensioning and tolerancing per ASME Y14.5M.

BSC: Basic Dimension. Theoretically exact value shown without tolerances.


REF: Reference Dimension, usually without tolerance, for information purposes only.

Microchip Technology Drawing C04-086B

# **Packaging Information**

8-Lead Plastic Thin Shrink Small Outline (ST) - 4.4 mm Body [TSSOP]

**Note:** For the most current package drawings, please see the Microchip Packaging Specification located at http://www.microchip.com/packaging

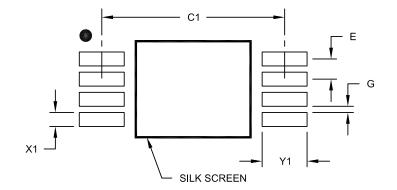

#### RECOMMENDED LAND PATTERN

	Units			MILLIMETERS			
Dimension	Limits	MIN	NOM	MAX			
Contact Pitch	E	0.65 BSC					
Contact Pad Spacing	C1		5.90				
Contact Pad Width (X8)	X1			0.45			
Contact Pad Length (X8)	Y1			1.45			
Distance Between Pads	G	0.20					

Notes:


1. Dimensioning and tolerancing per ASME Y14.5M

BSC: Basic Dimension. Theoretically exact value shown without tolerances.

Microchip Technology Drawing No. C04-2086A

## 8-Lead Ultra Thin Plastic Dual Flat, No Lead Package (Q4B) - 2x3 mm Body [UDFN] Atmel Legacy YNZ Package

**Note:** For the most current package drawings, please see the Microchip Packaging Specification located at http://www.microchip.com/packaging

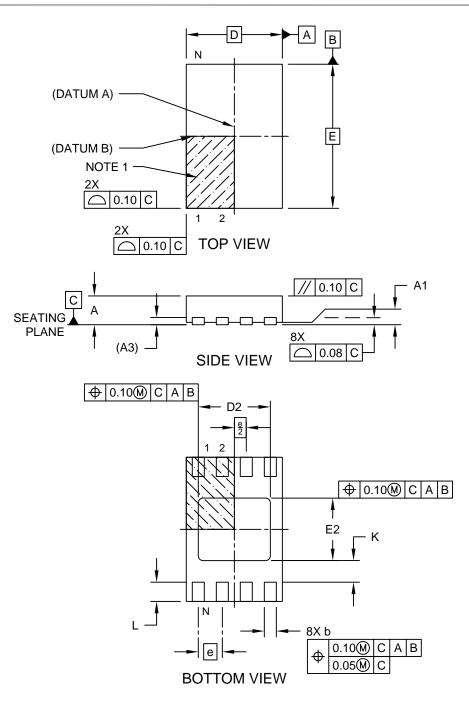


Microchip Technology Drawing C04-21355-Q4B Rev A Sheet 1 of 2

## **Packaging Information**

## 8-Lead Ultra Thin Plastic Dual Flat, No Lead Package (Q4B) - 2x3 mm Body [UDFN] Atmel Legacy YNZ Package

**Note:** For the most current package drawings, please see the Microchip Packaging Specification located at http://www.microchip.com/packaging

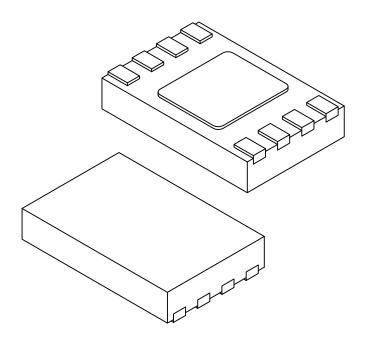

	Units	MILLIMETERS			
Dimension	Limits	MIN	NOM	MAX	
Number of Terminals	N	8			
Pitch	е	0.50 BSC			
Overall Height	A	0.50	0.55	0.60	
Standoff	A1	0.00	0.02	0.05	
Terminal Thickness	A3	0.152 REF			
Overall Length	D	2.00 BSC			
Exposed Pad Length	D2	1.40	1.50	1.60	
Overall Width	E	3.00 BSC			
Exposed Pad Width	E2	1.20	1.30	1.40	
Terminal Width	b	0.18	0.25	0.30	
Terminal Length	L	0.35	0.40	0.45	
Terminal-to-Exposed-Pad	K	0.20	-	-	

Notes:

1. Pin 1 visual index feature may vary, but must be located within the hatched area.

2. Package is saw singulated

3. Dimensioning and tolerancing per ASME Y14.5M


BSC: Basic Dimension. Theoretically exact value shown without tolerances.

REF: Reference Dimension, usually without tolerance, for information purposes only.

Microchip Technology Drawing C04-21355-Q4B Rev A Sheet 2 of 2

## 8-Lead Ultra Thin Plastic Dual Flat, No Lead Package (Q4B) - 2x3 mm Body [UDFN] Atmel Legacy YNZ Package

**Note:** For the most current package drawings, please see the Microchip Packaging Specification located at http://www.microchip.com/packaging

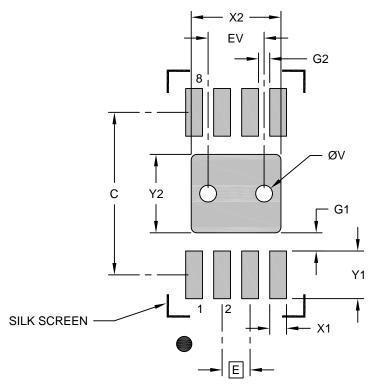

## RECOMMENDED LAND PATTERN

Units		MILLIMETERS		
Dimension Limits		MIN	NOM	MAX
Contact Pitch	E	0.50 BSC		
Optional Center Pad Width	X2			1.60
Optional Center Pad Length	Y2			1.40
Contact Pad Spacing	С		2.90	
Contact Pad Width (X8)	X1			0.30
Contact Pad Length (X8)	Y1			0.85
Contact Pad to Center Pad (X8)	G1	0.20		
Contact Pad to Contact Pad (X6)	G2	0.33		
Thermal Via Diameter	V		0.30	
Thermal Via Pitch	EV		1.00	

#### Notes:


1. Dimensioning and tolerancing per ASME Y14.5M

BSC: Basic Dimension. Theoretically exact value shown without tolerances.

2. For best soldering results, thermal vias, if used, should be filled or tented to avoid solder loss during reflow process

Microchip Technology Drawing C04-21355-Q4B Rev A

# **Packaging Information**

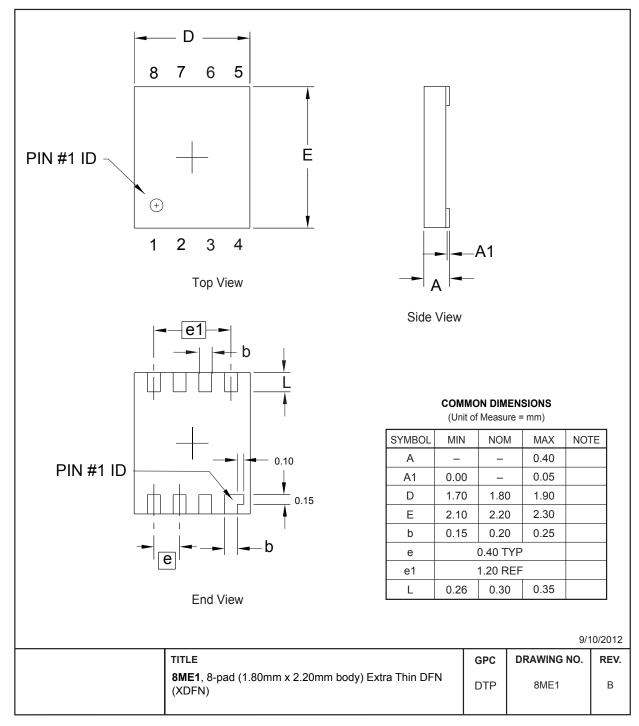

**Note:** For the most current package drawings, please see the Microchip Packaging Specification located at http://www.microchip.com/packaging.

# AT25080B/AT25160B Packaging Information

#### 0.10 (4X) 0.08 C // 0.10 C Е A Ď 0.15 ∭ C A B PIN 1 BALL PAD CORNER 固 A2 TOP VIEW SIDE VIEW **PIN 1 BALL PAD CORNER** 3 4 2 d (d1) COMMON DIMENSIONS (Unit of Measure - mm) - e-(e1)\_ SYMBOL MIN NOM MAX NOTE BOTTOM VIEW А 0.73 0.79 0.85 8 SOLDER BALLS A1 0.09 0.14 0.19 A2 0.40 0.45 0.50 Notes: 0.20 b 0.25 0.30 2 1. This drawing is for general information only. D 1.50 BSC Е 2.0 BSC 2. Dimension 'b' is measured at maximum solder ball diameter. е 0.50 BSC e1 0.25 REF 3. Solder ball composition shall be 95.5Sn-4.0Ag-.5Cu. d 1.00 BSC d1 0.25 REF 7/1/14 TITLE GPC DRAWING NO. REV. 8U3-1, 8-ball, 1.50mm x 2.00mm body, 0.50mm pitch, GXU 8U3-1 G Very Thin, Fine-Pitch Ball Grid Array Package (VFBGA)

**Note:** For the most current package drawings, please see the Microchip Packaging Specification located at http://www.microchip.com/packaging.

# 10. Revision History

#### Revision A (August 2019)

Updated to the Microchip template. Microchip DS20006244 replaces Atmel document 5228. Updated Part Marking Information. Added ESD rating. Removed the 8-ball WLCSP detail and ordering code. Removed lead finish designation. Added POR recommendations section. Updated trace code format in package markings. Updated section content throughout for clarification. Updated the 8U3-1 VFBGA package drawing. Updated the SOIC, TSSOP and UDFN package drawings to the Microchip equivalents.

#### Atmel Document 5228 Revision G (January 2015)

Add the AT25080B-MAHL-E and AT25160B-MAHL-E package options. Update the 8MA2 and 8U-12 package drawings and the ordering information.

#### Atmel Document 5228 Revision F (July 2014)

Add WLSCP package option. Update 8X, 8MA2, 8ME1, and 8U3-1 package drawings. Update template, Atmel logos, disclaimer page.

#### Atmel Document 5228 Revision E (March 2012)

Update 8A2 to 8X and 8S1, 8MA2, 8U3-1 package drawings.

#### Atmel Document 5228 Revision D (April 2010)

Update Ordering Code Detail and Ordering Information.

#### Atmel Document 5228 Revision C (August 2009)

Change Catalog Scheme and add Marking Details.

#### Atmel Document 5228 Revision B (July 2008)

Change 'Endurance' parameter on page 6.

## Atmel Document 5228 Revision A (September 2007)

Initial document release.

# The Microchip Website

Microchip provides online support via our website at http://www.microchip.com/. This website is used to make files and information easily available to customers. Some of the content available includes:

- **Product Support** Data sheets and errata, application notes and sample programs, design resources, user's guides and hardware support documents, latest software releases and archived software
- General Technical Support Frequently Asked Questions (FAQs), technical support requests, online discussion groups, Microchip design partner program member listing
- **Business of Microchip** Product selector and ordering guides, latest Microchip press releases, listing of seminars and events, listings of Microchip sales offices, distributors and factory representatives

# **Product Change Notification Service**

Microchip's product change notification service helps keep customers current on Microchip products. Subscribers will receive email notification whenever there are changes, updates, revisions or errata related to a specified product family or development tool of interest.

To register, go to http://www.microchip.com/pcn and follow the registration instructions.

# **Customer Support**


Users of Microchip products can receive assistance through several channels:


- Distributor or Representative
- Local Sales Office
- Embedded Solutions Engineer (ESE)
- Technical Support

Customers should contact their distributor, representative or ESE for support. Local sales offices are also available to help customers. A listing of sales offices and locations is included in this document.

Technical support is available through the website at: http://www.microchip.com/support

# **Product Identification System**

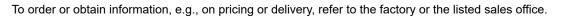

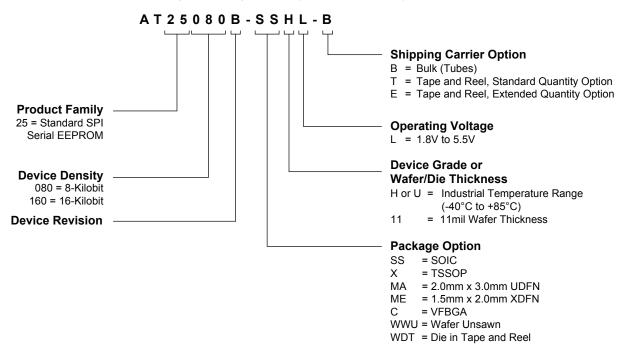

Note: Refer to automotive data sheet for automotive grade ordering information.

Examples:

Device	Package	Package Drawing Code	Package Option	Shipping Carrier Option	Device Grade
AT25080B-SSHL-B	SOIC	SN	SS	Bulk (Tubes)	Industrial
AT25080B-SSHL-T	SOIC	SN	SS	Tape and Reel	Temperature (-40°C to 85°C)
AT25160B-SSHL-T	SOIC	SN	SS	Tape and Reel	
AT25080B-XHL-B	TSSOP	ST	Х	Bulk (Tubes)	
AT25160B-XHL-T	TSSOP	ST	Х	Tape and Reel	
AT25080B-MAHL-E	UDFN	Q4B	MA	Tape and Reel	
AT25160B-MAHL-T	UDFN	Q4B	MA	Tape and Reel	
AT25160B-MAHL-E	UDFN	Q4B	MA	Tape and Reel	
AT25080B-MEHL-T	XDFN	8ME1	ME	Tape and Reel	
AT25160B-MEHL-T	XDFN	8ME1	ME	Tape and Reel	
AT25160B-CUL-T	VFBGA	8U3-1	С	Tape and Reel	

# **Microchip Devices Code Protection Feature**

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- · Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

# Legal Notice

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

# Trademarks

The Microchip name and logo, the Microchip logo, Adaptec, AnyRate, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, chipKIT, chipKIT logo, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, HELDO, IGLOO, JukeBlox, KeeLoq, Kleer, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PackeTime, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TempTrackr, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, FlashTec, Hyper Speed Control, HyperLight Load, IntelliMOS, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, Vite, WinPath, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, BlueSky, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, EtherGREEN, In-Circuit Serial Programming, ICSP, INICnet, Inter-Chip Connectivity, JitterBlocker, KleerNet, KleerNet logo, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, SAM-ICE, Serial Quad I/O, SMART-I.S., SQI, SuperSwitcher, SuperSwitcher II, Total Endurance, TSHARC, USBCheck, VariSense, ViewSpan, WiperLock, Wireless DNA, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

© 2019 Microchip Technology Inc.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2019, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

ISBN: 978-1-5224-4967-6

AMBA, Arm, Arm7, Arm7TDMI, Arm9, Arm11, Artisan, big.LITTLE, Cordio, CoreLink, CoreSight, Cortex, DesignStart, DynamIQ, Jazelle, Keil, Mali, Mbed, Mbed Enabled, NEON, POP, RealView, SecurCore, Socrates, Thumb, TrustZone, ULINK, ULINK2, ULINK-ME, ULINK-PLUS, ULINKpro, μVision, Versatile are trademarks or registered trademarks of Arm Limited (or its subsidiaries) in the US and/or elsewhere.

# **Quality Management System**

For information regarding Microchip's Quality Management Systems, please visit http://www.microchip.com/quality.



# **Worldwide Sales and Service**

nandler, AZ 85224-6199         China - Beijing         India - New Delhi         Fax: 43-7.           At: 480-792-7200         Tel: 86-10-8569-7000         Tel: 91-11-4160-8631         Denmark           ax: 480-792-7277         China - Chengdu         India - Pune         Tel: 45-44           achnical Support:         Tel: 86-28-8665-5511         Tel: 91-20-4121-0141         Fax: 45-44           tp://www.microchip.com/support         China - Chongqing         Japan - Osaka         Finland -           eb Address:         Tel: 86-23-8980-9588         Tel: 81-6-6152-7160         Tel: 358-9           tp://www.microchip.com         China - Dongguan         Japan - Tokyo         France - I           tanta         Tel: 86-769-8702-9880         Tel: 81-3-6880- 3770         Tel: 33-14           dt: 678-957-9614         Tel: 86-20-8755-8029         Tel: 82-53-744-4301         Germany           ax: 678-957-1455         China - Hangzhou         Korea - Seoul         Tel: 49-89           ax: 678-957-1455         China - Hang Kong SAR         Malaysia - Kuala Lumpur         Tel: 49-21           bistin, TX         Tel: 86-571-8792-8115         Tel: 60-3-7651-7906         Germany           dt: 574-760-0087         Tel: 86-25-8473-2460         Tel: 60-4-227-8870         Germany           at: 774-760-0088         China -	:
best       Tel: 61-2-9868-6733       Tel: 91-80-3090-4444       Tel: 43-72         handler, AZ 85224-6199       China - Beijing       India - New Delhi       Fax: 43-72         handler, AZ 85224-6199       China - Chengdu       India - New Delhi       Fax: 43-72         handler, AZ 85224-6199       Tel: 86-18-6569-7000       Tel: 91-12-4160-8631       Denmark         have 30000       Tel: 81-0-6152-7160       Tel: 45-44         have 30000       Tel: 81-66152-7160       Tel: 33-14         handler 300000       Tel: 82-63-748-8029       Tel: 81-3-6880-3770       Tel: 33-14         handler 300000       Tel: 82-63-744-4301       Germany       Fax: 33-1         hit 678-657-9614       Tel: 68-671-8792-8115       Tel: 82-2554-7200       Germany         hit 512-257-3370       China - Hong Kong SAR       Malaysia - Nala       Tel: 49-80         hit 774-760-0087       Tel: 66-223-43600       Tel: 60-3-7651-7906       Germany         hit 30-285-0071       Tel: 66-232-8502-7355       Tel: 63-2634-8005       Germany         hit 30-285-0071       Tel: 66-232-8500-7355       Tel: 63-2634-8070       Tel: 49-87         hit 30-285-0071       Tel: 66-233-1526       Tel: 49-71       Tel: 49-71         hit 30-285-0071       Tel: 66-233-1526       Tel: 886-2-7330       <	Wels
handler, AZ 85224-6199         China - Beijing         India - New Delhi         Fax: 43-7           it: 480-792-7207         Tei: 86-10-869-7000         India - New Delhi         Fax: 43-7           it: 480-792-7207         Tei: 86-10-869-7000         India - Pune         Tei: 45-44           chnical Support:         Tei: 86-28-8665-5511         Tei: 91-12-04121-01411         Fax: 45-4           tp://www.microchip.com/support         China - Chongqiun         Japan - Osaka         Finland           tei: 86-738-9800-9588         Tei: 81-36803-3770         Tei: 83-7899-7456         France - 1           tei: 86-739-8702-9880         Tei: 81-36880-3770         Tei: 83-784-4301         Germany           te: 678-957-9614         Tei: 86-79-18792-8115         Tei: 82-2-557-44-4301         Germany           te: 678-957-9451         Tei: 82-2-557-44-4301         Germany           te: 512-257-3370         China - Hangzhou         Korea - Seoul         Tei: 49-21           te: 512-257-3370         China - Manjing         Malaysia - Kuala Lumpur         Tei: 49-21           te: 512-257-3370         China - Shanghai         Singapore         Tei: 49-21           te: 52-2547-3200         Germany         Tei: 63-2-6343-48670         Fax: 49-8           te: 630-285-0075         China - Shanghai         Singapore	242-2244-39
i: 480-792-7200       Tel: 86-10-8569-7000       Tel: 91-11-4160-8631       Denmark         ix: 480-792-7277       China - Chengdu       India - Pune       Tel: 45-44         torhical Support:       Tel: 82-8665-5511       Tel: 91-20-4121-0141       Fa:: 45-44         tp://www.microchip.com/support       China - Chengqing       Japan - Osaka       Finland -         tp://www.microchip.com       China - Chengqing       Japan - Tokyo       France -         jp://www.microchip.com       China - Guangzhou       Korea - Daegu       Fa:: 33-14         id: 678-957-9614       Tel: 86-70-8755-8029       Tel: 82-53-744-4301       Germany         id: 678-957-1455       China - Hangzhou       Korea - Seoul       Tel: 49-21         stsin, TX       Tel: 86-571-8792-8115       Tel: 80-37651-7906       Germany         it: 512-257.3370       China - Nanjing       Malaysia - Kuala Lumpur       Tel: 49-21         stoin       Tel: 86-52-8473-2460       Tel: 60-37651-7906       Germany         stoin       Tel: 86-52-8473-2460       Tel: 60-32-8502       Germany         stoin - Qingdao       Tel: 86-52-8473-2460       Tel: 86-32-48070       Germany         stoin - Shenghai       Singapore       Tel: 86-49-808       Tel: 49-698         ti: 630-285-0071       Tel: 86-75	242-2244-393
xx: 480-792-7277       China - Chengdu       India - Pune       Tel: 45-44         chnical Support:       Tel: 86-28-8665-5511       Tel: 91-20-4121-0141       Fax: 45-44         bp://www.microchip.com/Support       China - Chongqing       Japan - Osaka       Finland -         bp://www.microchip.com       China - Dongguan       Japan - Tokyo       France - I         danta       Tel: 86-769-8702-9880       Tel: 81-66152-7160       Tel: 33-14         uich, GA       China - Guangzhou       Korea - Daegu       Fax: 33-14         uich, GA       China - Hong Kong SAR       Tel: 82-53-744-4301       Germany         x: 678-957-9614       Tel: 86-20-8755-8029       Tel: 82-554-7200       Germany         x: 678-957-9614       Tel: 86-71-8792-8115       Tel: 82-254-7200       Germany         x: 678-957-1455       China - Hong Kong SAR       Malaysia - Kuala Lumpur       Tel: 49-21         y: 774-760-0087       Tel: 86-25-8473-2460       Tel: 60-4-227-8870       Germany         x: 630-285-0071       Tel: 86-21-3326-8000       Tel: 66-334-8870       Fax: 49-81         x: 630-285-0075       China - Shenyang       Taiwan - Haine Chu       Germany         x: 972-818-7423       Tel: 86-186-6233-1526       Tel: 866-337-78366       Tel: 49-92         x: 930-455	- Copenhagen
chnical Support:         Tel: 86-28-8665-5511         Tel: 91-20-4121-0141         Fax: 45-4           (p)//www.microchip.com/ eb Address:         China - Chongqing         Japan - Osaka         Finland - Tel: 86-28-8800-9588           (p)//www.microchip.com         China - Dongguan         Japan - Tokyo         France - J           Janta         Tel: 86-769-8702-9880         Tel: 81-3-6880-3770         Tel: 83-48           Juth, GA         China - Guangzhou         Korea - Daegu         Fax: 33-1           K: 678-957-9614         Tel: 86-718/792-8115         Tel: 82-5744-4301         Germany           K: 678-957-370         China - Hangzhou         Korea - Seoul         Tel: 49-89           is 512-257-3370         China - Hangzhou         Korea - Seoul         Tel: 49-89           is 512-257-3370         China - Nanjing         Malaysia - Venang         Tel: 49-72           pston         Tel: 86-25-8473-2460         Tel: 60-4227-8870         Germany           is 774-760-0088         China - Shanghai         Singapore         Tel: 49-971           is 630-285-0071         Tel: 86-25-8473-2460         Tel: 65-6334-8870         Fax: 49-87           is 630-285-0075         China - Shenyang         Taiwan - Haing Chu         Germany           is 630-285-0075         China - Shenyang         Taiwan -	
p://www.microchip.com/support         China - Chongqing         Japan - Osaka         Finland -           eb Address:         Tel: 86-23-8980-9588         Tel: 81-6-6152-7160         Tel: 83-14           p://www.microchip.com         China - Dongguan         Japan - Tokyo         France -           lanta         Tel: 86-769-8702-9980         Tel: 81-3-6880-3770         Tel: 33-14           uluth, GA         China - Guangzhou         Korea - Daegu         Fa:: 33-14           uc: 678-957-1455         China - Hangzhou         Korea - Seoul         Tel: 49-83           us: 678-957-1455         China - Hangzhou         Korea - Seoul         Tel: 49-83           us: 678-957-1455         China - Hangzhou         Korea - Seoul         Tel: 49-80           ststn, TX         Tel: 86-52-18792-8115         Tel: 82-25-54-7200         Germany           ststn, TX         Tel: 86-52-8473-2460         Tel: 60-4-227-8870         Germany           estborough, MA         China - Nanjing         Malaysia - Penang         Tel: 49-71           t: 774-780-0087         Tel: 86-23-8370-27355         Tel: 60-4-227-8870         Germany           uscaga         Li         China - Shanghai         Singapore         Tel: 49-80           t: 630-285-0075         China - Shenyang         Taiwan - Hsin Chu	
be Address:       Tel: 86-23-8980-9588       Tel: 81-6-6152-7160       Tel: 358-9         tp://www.microchip.com       China - Dongguan       Japan - Tokyo       France - I         tanta       Tel: 86-769-8702-9880       Tel: 81-3-6880-3770       Tel: 33-1         uth, GA       China - Guangzhou       Korea - Daegu       Fax: 33-1         t: 678-957-9614       Tel: 86-571-8792-8115       Tel: 82-53-744-4301       Germany         x:: 678-957-1455       China - Hangzhou       Korea - Seoul       Tel: 49-21         stin, TX       Tel: 86-571-8792-8115       Tel: 82-554-7200       Germany         stin, TX       Tel: 86-251-8792-8410       Tel: 82-2945-700       Germany         stin, TX       Tel: 86-571-8792-2460       Tel: 80-22-76870       Germany         stin, TX       Tel: 86-52-8473-2460       Tel: 62-2-78970       Germany         xi: 774-760-0087       Tel: 86-532-8502-7355       Tel: 63-2-634-9065       Germany         xi: 774-760-0088       China - Shanghai       Singapore       Tel: 49-89         xi: 630-285-0075       China - Shanghai       Singapore       Tel: 49-89         xi: 630-285-0075       China - Shenzhen       Tal: 86-756-834-8200       Tel: 86-757-8366       Tel: 99-72         xi: 972-818-2924       China - Suazhen <td></td>	
Ip://www.microchip.com         China - Dongguan         Japan - Tokyo         France - I           Ianta         Tel: 86-769-8702-9880         Tel: 81-3-6880-3770         Tel: 33-41           Jauth, GA         China - Guangzhou         Korea - Daegu         Fax: 33-41           Lic 78-957-9614         Tel: 86-20-8755-8029         Tel: 82-35-744-4301         Germany           K: 678-957-1455         China - Hangzhou         Korea - Seoul         Tel: 49-89           Jstin, TX         Tel: 86-571-8792-8115         Tel: 82-2-554-7200         Germany           Vis: 678-957-1455         China - Hong Kong SAR         Malaysia - Kuala Lumpur         Tel: 49-29           Saton         Tel: 86-571-8792-8115         Tel: 60-3-7651-7906         Germany           Settorough, MA         China - Nanjing         Malaysia - Penang         Tel: 49-72           Nar, 774-760-0087         Tel: 86-524-732460         Tel: 60-24-634-8670         Germany           Sica, IL         China - Shanghai         Singapore         Tel: 49-89           Vis: 630-285-0071         Tel: 86-24-13326-8000         Tel: 68-33-8770         Fax: 49-80           Vis: 630-285-0075         China - Shenyang         Taiwan - Kaohsiung         Israel - R           Vis: 724-781-7230         Tel: 86-75-8864-2200         Tel: 866-721-37830	9-4520-820
Itanta         Tel: 86-769-8702-9880         Tel: 81-3-6880-3770         Tel: 33-14           Juth, GA         China - Guangzhou         Korea - Daegu         Fax: 33-14           Id: 678-957-9614         Tel: 86-20-8755-8029         Tel: 82-53-7444301         Germany           Id: 678-957-1455         China - Hangzhou         Korea - Seoul         Tel: 49-89           Istin, TX         Tel: 86-571-8792-8115         Tel: 82-2554-7200         Germany           Id: 572-5803         Tel: 85-2543-5100         Tel: 60-3-7651-7906         Germany           Siston         Tel: 86-25-8473-2460         Tel: 60-4-227-8870         Germany           Id: 774-760-0087         Tel: 86-532-8502-7355         Tel: 60-4-227-8870         Germany           Singapore         Tel: 49-80         Singapore         Tel: 49-80           Id: 63-285-0071         Tel: 66-21-3326-8000         Tel: 65-633-48870         Fax: 49-80           X: 630-285-0075         China - Shangnai         Singapore         Tel: 49-00           Id: 97-2818-7423         Tel: 86-186-623-4234         Tel: 86-7-213-7830         Tel: 97-28           X: 972-818-2924         China - Shangtai         Taiwan - Kaohsiung         Isael - R           X: 972-818-2924         China - Sacal - 2208-833-7522         Tel: 86-7-213-7830         Tel: 97-03	
Julth, GA         China - Guangzhou         Korea - Daegu         Fax: 33-4           i: 678-957-9614         Tel: 86-20-8755-8029         Tel: 82-53-744-4301         Germany           xx: 678-957-1455         China - Hangzhou         Korea - Seoul         Tel: 49-80           setin, TX         Tel: 86-571-8792-8115         Tel: 82-2554-7200         Germany           setin, TX         Tel: 86-571-8792-8115         Tel: 82-2547-7200         Germany           setin or Maine Nanjing         Malaysia - Kuala Lumpur         Tel: 49-21           seton         Tel: 86-25-847-32400         Tel: 60-3-7651-7906         Germany           settorough, MA         China - Nanjing         Malaysia - Penang         Tel: 49-21           seton         Tel: 86-25-8473-2460         Tel: 60-4227-8870         Germany           seton         Tel: 86-25-8473-2460         Tel: 63-2-634-9065         Germany           sica, IL         China - Shanghai         Singapore         Tel: 49-92           sica, So-285-0071         Tel: 86-21-3326-8000         Tel: 86-34-8870         Fax: 49-80           sic 630-285-0075         China - Shenzhen         Talwan - Kaohslung         Israel - R           sit: 972-9818-7423         Tel: 86-755-8864-2200         Tel: 866-37-13-78306         Tel: 972-9	69-53-63-20
ht: 678-957-9614       Tel: 86-20-8755-8029       Tel: 82-53-744-4301       Germany         xx: 678-957-1455       China - Hangzhou       Korea - Seoul       Tel: 49-92         xsin, TX       Tel: 86-571-8792-8115       Tel: 82-2554-7200       Germany         t: 512-257-3370       China - Hong Kong SAR       Malaysia - Kuala Lumpur       Tel: 49-21         pston       Tel: 852-2943-5100       Tel: 60-3-7651-7906       Germany         setborough, MA       China - Nanjing       Malaysia - Penang       Tel: 49-21         w: 774-760-0087       Tel: 86-25-8473-2480       Tel: 60-4-227-8870       Germany         w: 774-760-0088       China - Oingdao       Philippines - Manila       Tel: 49-72         w: 774-760-0088       China - Shanghai       Singapore       Tel: 49-80         w: 630-285-0071       Tel: 86-21-3326-8000       Tel: 65-334-870       Fax: 49-80         w: 630-285-0075       China - Shenzhen       Taiwan - Kaohsiung       Israel - R         allas       Tel: 86-24-2334-2829       Tel: 86-37-78366       Tel: 972-91         allas       Tel: 86-186-6233-1526       Tel: 886-32-508-8600       Tel: 972-91         w: 972-818-2924       China - Suzhou       Taiwan - Taipei       Italy - Mil         atrot       Tel: 86-27-5980-5300 <td< td=""><td>-69-30-90-79</td></td<>	-69-30-90-79
xx: 678-957-1455         China - Hangzhou         Korea - Seoul         Tel: 91-90           istin, TX         Tel: 86-571-8792-8115         Tel: 82-2554-7200         Germany           it: 512-257-3370         China - Hong Kong SAR         Malaysia - Kuala Lumpur         Tel: 49-21           oston         Tel: 852-2943-5100         Tel: 60-3-7651-7906         Germany           oston         Tel: 852-2943-5100         Tel: 60-3-7651-7906         Germany           x: 774-760-0087         Tel: 86-25-8473-2460         Tel: 60-4-227-8870         Germany           x:: 774-760-0088         China - Nanjing         Malaysia - Penang         Tel: 49-72           nicago         Tel: 86-523-8502-7355         Tel: 60-4-227-8870         Germany           x:: 630-285-0071         Tel: 86-21-3326-8000         Tel: 63-6334-8870         Fax: 49-80           x: 630-285-0075         China - Shenyang         Taiwan - Hsin Chu         Germany           allas         Tel: 86-755-8864-2200         Tel: 886-37-213-7830         Tel: 92-9           x: 972-818-7423         Tel: 86-755-8864-2200         Tel: 886-25-694-00         Tel: 92-9           x: 972-818-2924         China - Suzhou         Taiwan - Kaohsiung         Israel - R           oxi, MI         China - Xian         Yietnam - Ho Chi Minh         Tel: 3	/ - Garching
Justin, TX         Tel: 86-571-8792-8115         Tel: 82-2554-7200         Germany           d: 512-257-3370         China - Hong Kong SAR         Malaysia - Kuala Lumpur         Tel: 49-21           jston         Tel: 852-2943-5100         Tel: 60-3-7651-7906         Germany           jestborough, MA         China - Nanjing         Malaysia - Penang         Tel: 49-71           is 774-760-0087         Tel: 86-25-8473-2460         Tel: 60-3-7651-8906         Germany           jax: 774-760-0088         China - Qingdao         Philippines - Manila         Tel: 49-72           nicago         Tel: 86-25-8473-24600         Tel: 60-4-227-8870         Germany           jax: 630-285-0071         Tel: 86-21-3326-8000         Tel: 66-334-8670         Fax: 49-80           ic 630-285-0075         China - Shenyang         Taiwan - Hsin Chu         Germany           jalas         Tel: 86-24-2334-2829         Tel: 886-73-78306         Tel: 49-80           idison, TX         China - Shenzhen         Taiwan - Kaohsiung         Israel - R           i: 972-818-2924         China - Suzhou         Taiwan - Taipei         Italy - Mil           jetroit         Tel: 86-27-5980-5300         Tel: 86-2-2508-8600         Tel: 39-04           jet 281-894-5983         Tel: 86-756-3210040         Tel: 31-141	-
ht: 512-257-3370       China - Hong Kong SAR       Malaysia - Kuala Lumpur       Tel: 49-21         baston       Tel: 852-2943-5100       Tel: 60-3-7651-7906       Germany         setborough, MA       China - Nanjing       Malaysia - Penang       Tel: 49-71         tt: 774-760-0087       Tel: 86-25-8473-2460       Tel: 60-4-227-8870       Germany         wix: 774-760-0088       China - Shanghai       Tel: 60-4-227-8870       Germany         wix: 774-760-0088       China - Shanghai       Singapore       Tel: 49-72         nicago       Tel: 86-51-3326-8000       Tel: 65-348-870       Fax: 49-80         six: 630-285-0071       Tel: 86-24-2334-2829       Tel: 65-6334-8870       Fax: 49-80         dison, TX       China - Shenyang       Taiwan - Hsin Chu       Germany         at: 630-285-0075       China - Shenyang       Taiwan - Kaohsiung       Israel - R         didson, TX       China - Shenyang       Taiwan - Kaohsiung       Israel - R         at: 972-818-7423       Tel: 86-755-8864-2200       Tel: 866-7-213-7830       Tel: 79-29         parkott       Tel: 86-75-5864-2200       Tel: 886-2-2508-6600       Tel: 39-04         pot, MI       China - Wuhan       Thailand - Bangkok       Fax: 39-04         pot, MI       China - Stang       Tel:	
Deston         Tel: 852-2943-5100         Tel: 60-3-7651-7906         Germany           estborough, MA         China - Nanjing         Malaysia - Penang         Tel: 49-71           i: 774-760-0087         Tel: 86-25-8473-2460         Tel: 60-4-227-8870         Germany           pic.ago         China - Qingdao         Philippines - Manila         Tel: 49-71           pic.ago         Tel: 86-532-8502-7355         Tel: 63-2-634-9065         Germany           sica, IL         China - Shanghai         Singapore         Tel: 49-80           sica, October         China - Shenyang         Taiwan - Hsin Chu         Germany           sica, IL         China - Shenyang         Taiwan - Kaohsiung         Israel - R           sidison, TX         China - Shenzhen         Taiwan - Kaohsiung         Israel - R           sidison, TX         China - Suzhou         Taiwan - Taipei         Italy - Mil           etroit         Tel: 86-75-8864-2200         Tel: 86-7213-7830         Tel: 39-03           pol, MI         China - Suzhou         Taiwan - Taipei         Italy - Mil           etroit         Tel: 86-75-58864-2200         Tel: 86-624-1351         Italy - Mil           polaton, TX         China - Xian         Tel: 86-624-1351         Italy - Mil           china - Xian	129-3766400
estborough, MA         China - Nanjing         Malaysia - Penang         Tel: 49-7           d: 774-760-0087         Tel: 86-25-8473-2460         Tel: 60-4-227-8870         Germany           xx: 774-760-0088         China - Qingdao         Philippines - Manila         Tel: 49-72           nicago         Tel: 86-532-8502-7355         Tel: 60-4-227-8870         Germany           xx: 774-760-0088         China - Qingdao         Philippines - Manila         Tel: 49-80           sca, IL         China - Shanghai         Singapore         Tel: 49-80           sca, 30-285-0071         Tel: 86-21-3326-8000         Tel: 65-6334-8870         Fax: 49-80           xx: 630-285-0075         China - Shenyang         Taiwan - Hsin Chu         Germany           dison, TX         China - Shenzhen         Taiwan - Kaohsiung         Israel - R           xx: 972-818-723         Tel: 86-755-8864-2200         Tel: 886-3-771-8300         Tel: 792-9           xy: 972-818-2924         China - Suzhou         Taiwan - Taipei         Italy - Mil           china - Wuhan         Thailand - Bangkok         Fax: 39-0         Tel: 39-03           xy: 914-848-4000         Tel: 86-27-5980-5300         Tel: 68-264-1351         Italy - Pa           ouston, TX         China - Xiamen         Vietnam - Ho Chi Minh         Tel:	/ - Heilbronn
H: 774-760-0087       Tel: 86-25-8473-2460       Tel: 60-4-227-8870       Germany         xx: 774-760-0088       China - Qingdao       Philippines - Manila       Tel: 49-72         nicago       Tel: 86-532-8502-7355       Tel: 63-2-634-9065       Germany         sisca, IL       China - Shanghai       Singapore       Tel: 49-80         six: 630-285-0071       Tel: 86-21-3326-8000       Tel: 65-6334-8870       Fax: 49-80         xx: 630-285-0075       China - Shanghai       Singapore       Tel: 49-80         didison, TX       China - Shenzhen       Taiwan - Hain Chu       Germany         six: 630-285-0075       China - Shenzhen       Taiwan - Kaohsiung       Israel - R         didison, TX       China - Suzhou       Taiwan - Taipei       Italy - Mil         di 972-818-7423       Tel: 86-186-6233-1526       Tel: 86-2-508-8600       Tel: 39-03         xx: 972-818-7423       Tel: 86-186-6233-1526       Tel: 86-2-508-8600       Tel: 39-03         xi: 248-848-4000       Tel: 86-29-5980-5300       Tel: 66-2-694-1351       Italy - Pai         biosvin, TX       China - Xiam       Vietnam - Ho Chi Minh       Tel: 39-04         xi: 248-848-4000       Tel: 86-592-2388138       Fax: 31-41       Fax: 31-41         bibesville, IN       Tel: 86-756-3210040	
ax: 774-760-0088       China - Qingdao       Philippines - Manila       Tel: 49-7         nicago       Tel: 86-532-8502-7355       Tel: 63-2634-9065       Germany         usca, IL       China - Shanghai       Singapore       Tel: 49-89         i: 630-285-0071       Tel: 86-21-3326-8000       Tel: 65-6334-8870       Fax: 49-89         i: 630-285-0075       China - Shenyang       Taiwan - Hsin Chu       Germany         allas       Tel: 86-24-2334-2829       Tel: 86-3-577-8366       Tel: 49-80         i: 972-818-7423       Tel: 86-755-8864-2200       Tel: 86-3-577-8366       Tel: 972-81         i: 972-818-2924       China - Suzhou       Taiwan - Taipei       Italy - Mil         etroit       Tel: 86-186-6233-1526       Tel: 886-2-2508-8600       Tel: 39-03         ovi, MI       China - Wuhan       Thailand - Bangkok       Fax: 39-03         i: 248-848-4000       Tel: 86-27-5980-5300       Tel: 66-2694-1351       Italy - Par         ovis, MI       China - Xian       Vietnam - Ho Chi Minh       Tel: 39-04         i: 248-848-4000       Tel: 86-29-833-7252       Tel: 84-28-5448-2100       Netherlar         dianapolis       China - Xiam       Vietnam - Ho Chi Minh       Tel: 3141         oblesville, IN       Tel: 86-756-3210040       Tel: 47-22	/ - Karlsruhe
hicago       Tel: 86-532-8502-7355       Tel: 63-2634-9065       Germany         usca, IL       China - Shanghai       Singapore       Tel: 49-89         d: 630-285-0071       Tel: 86-21-3326-8000       Tel: 65-6334-8870       Fax: 49-80         xix: 630-285-0075       China - Shenyang       Taiwan - Hsin Chu       Germany         allas       Tel: 86-24-2334-2829       Tel: 86-3-577-8366       Tel: 49-80         idison, TX       China - Shenyang       Taiwan - Kaohsiung       Israel - R         id: 972-818-7423       Tel: 86-755-8864-2200       Tel: 886-3-577-8366       Tel: 972-9         xix: 972-818-7423       Tel: 86-186-6233-1526       Tel: 886-7-213-7830       Tel: 972-9         xix: 972-818-2924       China - Suzhou       Taiwan - Taipei       Italy - Mil         etroit       Tel: 86-186-6233-1526       Tel: 886-2-2508-8600       Tel: 39-03         poi, MI       China - Xian       Thailand - Bangkok       Fax: 39-03         ci: 248-848-4000       Tel: 86-27-5980-5300       Tel: 86-22-694-1351       Italy - Pai         poiston, TX       China - Xian       Vietnam - Ho Chi Minh       Tel: 39-04         ci: 248-848-4000       Tel: 86-22-2388138       Fax: 314       Fax: 314         bolebsville, IN       Tel: 86-552-2388137252	
issca, IL       China - Shanghai       Singapore       Tel: 49-89         issca, IL       China - Shanghai       Singapore       Tel: 49-89         ist 630-285-0071       Tel: 86-21-3326-8000       Tel: 65-6334-8870       Fax: 49-80         ax: 630-285-0075       China - Shenyang       Taiwan - Hsin Chu       Germany         allas       Tel: 86-24-2334-2829       Tel: 866-3-577-8366       Tel: 49-80         idison, TX       China - Shenzhen       Taiwan - Kaohsiung       Israel - R         it: 972-818-7423       Tel: 86-755-8864-2200       Tel: 886-7-213-7830       Tel: 972-9         ax: 972-818-7423       Tel: 86-756-82100       Tel: 886-7213-7830       Tel: 39-03         bit 248-848-4000       Tel: 86-756-3210040       Tel: 84-28-5448-2100       Netherlar         bibesville, IN       Tel: 86-756-3210040       Tel: 47-72       Poland -         bit: 317-773-8453       Tel: 86-756-3210040       Tel: 47-72       Poland -         bit: 317-773-8453       Tel: 86-756	
h: 630-285-0071       Tel: 86-21-3326-8000       Tel: 65-6334-8870       Fax: 49-8         ax: 630-285-0075       China - Shenyang       Taiwan - Hsin Chu       Germany         allas       Tel: 86-24-2334-2829       Tel: 886-3-577-8366       Tel: 49-80         bdison, TX       China - Shenzhen       Taiwan - Kaohsiung       Israel - R         d: 972-818-7423       Tel: 86-755-8864-2200       Tel: 886-7-213-7830       Tel: 972-9         ax: 972-818-2924       China - Suzhou       Taiwan - Taipei       Italy - Mil         betroit       Tel: 86-186-6233-1526       Tel: 886-2-2508-8600       Tel: 39-03         oxi, MI       China - Wuhan       Thailand - Bangkok       Fax: 39-03         d: 248-848-4000       Tel: 86-29-8833-7252       Tel: 84-28-5448-2100       Netherlar         dianapolis       China - Xiamen       Tel: 31-41       Fax: 31-41         obselsville, IN       Tel: 86-756-3210040       Tel: 84-28-5448-2100       Nerway -         Yei: 317-773-8453       Tel: 86-756-3210040       Tel: 47-72       Poland -         Yei Sangeles       Tel: 86-756-3210040       Tel: 47-72       Poland -         Yei Say -462-9608       Tel: 86-756-3210040       Tel: 47-72       Poland -         Yei Say -462-9608       Yei Say -462-9608       Spain -	
Ax: 630-285-0075         China - Shenyang         Taiwan - Hsin Chu         Germany           allas         Tel: 86-24-2334-2829         Tel: 886-3-577-8366         Tel: 49-80           idison, TX         China - Shenzhen         Taiwan - Kaohsiung         Israel - R           idison, TX         China - Shenzhen         Taiwan - Kaohsiung         Israel - R           idison, TX         China - Suzhou         Tel: 886-7-213-7830         Tel: 972-9           ix: 972-818-2924         China - Suzhou         Taiwan - Taipei         Italy - Mil           atroit         Tel: 86-186-6233-1526         Tel: 886-2-2508-8600         Tel: 39-03           ovi, MI         China - Wuhan         Thailand - Bangkok         Fax: 39-03           id: 248-848-4000         Tel: 86-27-5980-5300         Tel: 66-2-694-1351         Italy - Par           ouston, TX         China - Xian         Vietnam - Ho Chi Minh         Tel: 39-04           id: 248-848-4000         Tel: 86-592-2388138         Tel: 84-28-5448-2100         Netherlar           dianapolis         China - Zhuhai         Fax: 31-44         Fax: 31-44           id: 317-773-5453         Tel: 86-756-3210040         Tel: 47-72           id: 317-536-2380         Fak: 34-9         Fak: 49-21           ission Viejo, CA         Fak: 34-9 <td>39-627-144-44</td>	39-627-144-44
allas       Tel: 86-24-2334-2829       Tel: 886-3-577-8366       Tel: 49-80         idison, TX       China - Shenzhen       Taiwan - Kaohsiung       Israel - R         id: 972-818-7423       Tel: 86-755-8864-2200       Tel: 886-7-213-7830       Tel: 972-9         ix: 972-818-7924       China - Suzhou       Taiwan - Taipei       Italy - Mil         etroit       Tel: 86-186-6233-1526       Tel: 886-2-2508-8600       Tel: 39-03         ovi, MI       China - Wuhan       Thailand - Bangkok       Fax: 39-04         d: 248-848-4000       Tel: 86-27-5980-5300       Tel: 66-2-694-1351       Italy - Pat         ouston, TX       China - Xian       Vietnam - Ho Chi Minh       Tel: 39-04         d: 281-894-5983       Tel: 86-29-2388138       Tel: 84-28-5448-2100       Netherlar         dianapolis       China - Xiamen       Tel: 86-756-3210040       Tel: 84-28-5448-2100       Netherlar         x: 317-773-8323       Tel: 86-756-3210040       Tel: 84-28-5448-2100       Netherlar       Norway -         x: 317-773-8323       Tel: 86-756-3210040       Tel: 49-21       Sa for an	/ - Rosenheim
ddison, TX       China - Shenzhen       Taiwan - Kaohsiung       Israel - R         ddison, TX       Tel: 86-755-8864-2200       Tel: 886-7-213-7830       Tel: 972-9         ax: 972-818-2924       China - Suzhou       Taiwan - Taipei       Italy - Mil         betroit       Tel: 86-186-6233-1526       Tel: 886-2-2508-8600       Tel: 39-03         byi, Ml       China - Wuhan       Thailand - Bangkok       Fax: 39-0         betroit       Tel: 86-27-5980-5300       Tel: 66-2-694-1351       Italy - Par         buston, TX       China - Xian       Vietnam - Ho Chi Minh       Tel: 39-04         buston, TX       China - Xian       Vietnam - Ho Chi Minh       Tel: 39-04         buston, TX       China - Xianen       Tel: 84-28-5448-2100       Netherlar         clianapolis       China - Zhuhai       Tel: 86-756-3210040       Tel: 47-72         buston / Viejo, CA       Tel: 86-756-3210040       Tel: 40-21       Xi 249-462-9608       Tel: 40-21         ax: 949-462-9608       Tel: 301-773-7800       Tel: 34-91       Spain - M       Tel: 34-91         aleigh, NC       Hi 919-844-7510       Fax: 34-9       Sweden -       Sweden -	031-354-560
al: 972-818-7423       Tel: 86-755-8864-2200       Tel: 876-7213-7830       Tel: 972-9         ax: 972-818-2924       China - Suzhou       Taiwan - Taipei       Italy - Mil         betroit       Tel: 86-186-6233-1526       Tel: 886-2-2508-8600       Tel: 39-03         bovi, MI       China - Wuhan       Thailand - Bangkok       Fax: 39-03         bovi, MI       China - Xian       Tel: 66-2-694-1351       Italy - Par         bouston, TX       China - Xian       Vietnam - Ho Chi Minh       Tel: 39-04         bouston, TX       China - Xian       Vietnam - Ho Chi Minh       Tel: 39-04         bolesville, IN       Tel: 86-29-8833-7252       Tel: 84-28-5448-2100       Netherlar         chia - Zhuhai       Tel: 86-756-3210040       Tel: 84-28-5448-2100       Netway-         chi : 317-773-8323       China - Zhuhai       Norway -       Tel: 47-72         chi : 317-773-6453       Tel: 86-756-3210040       Tel: 48-22       Romania         chi : 949-462-9608       Tel: 86-756-3210040       Tel: 40-21       Spain - M         chi : 949-462-9608       Tel: 34-91       Fax: 34-9       Spain - M         chi : 949-462-9608       Tel: 34-91       Fax: 34-9       Spain - M         chi : 919-844-7510       Fay 19-844-7510       Sweden -       Swede	
Ax: 972-818-2924       China - Suzhou       Taiwan - Taipei       Italy - Mil         betroit       Tel: 86-186-6233-1526       Tel: 886-2-2508-8600       Tel: 39-03         bovi, MI       China - Wuhan       Thailand - Bangkok       Fax: 39-03         bovi, MI       China - Xian       Tel: 66-2-694-1351       Italy - Par         bouston, TX       China - Xian       Vietnam - Ho Chi Minh       Tel: 39-04         bouston, TX       China - Xian       Vietnam - Ho Chi Minh       Tel: 39-04         clianapolis       China - Xiamen       Tel: 84-28-5448-2100       Netherlar         clistarian - Traisan       Tel: 86-592-2388138       Fax: 31-41       Fax: 31-41         bolesville, IN       Tel: 86-756-3210040       Tel: 84-28-5448-2100       Nerway -         ax: 317-773-8323       China - Zhuhai       Norway -       Tel: 47-72         bolesville, IN       Tel: 86-756-3210040       Tel: 48-22       Romania         c) 949-462-9608       Tel: 86-756-3210040       Tel: 48-22       Spain - M         c) 949-462-9608       Tel: 34-91       Fax: 34-9       Spain - M         c) 949-962-9608       Tel: 34-91       Fax: 34-9       Spain - M         d: 919-844-7510       Fay 194-844-7510       Sweden -       Sweden -     <	
atroit       Tel: 86-186-6233-1526       Tel: 886-2-2508-8600       Tel: 39-03         byi, MI       China - Wuhan       Thailand - Bangkok       Fax: 39-0         buston, TX       China - Xian       Tel: 66-2-694-1351       Italy - Par         buston, TX       China - Xian       Vietnam - Ho Chi Minh       Tel: 39-03         buston, TX       China - Xian       Vietnam - Ho Chi Minh       Tel: 39-04         buston, TX       China - Xian       Vietnam - Ho Chi Minh       Tel: 39-04         buston, TX       China - Xiamen       Tel: 84-28-5448-2100       Netherlan         cli 317-773-8323       China - Zhuhai       Fax: 31-41       Fax: 31-41         bubesville, IN       Tel: 86-756-3210040       Tel: 47-72       Poland -1         buston Viejo, CA       Tel: 86-756-3210040       Tel: 48-22       Fax: 31-41         buston Viejo, CA       Fay 949-462-9608       Tel: 40-21       Spain - M         buston Viejo, CA       Follow       Fay: 34-91       Fay: 34-91         fei 391-273-7800       Fei: 34-91       Fay: 34-91       Fay: 34-91         aleigh, NC       Figure 44-7510       Sweden -       Sweden -	
Swi, MI         China - Wuhan         Thailand - Bangkok         Fax: 39-0           4: 248-848-4000         Tel: 86-27-5980-5300         Tel: 66-2-694-1351         Italy - Par           Subston, TX         China - Xian         Vietnam - Ho Chi Minh         Tel: 39-04           4: 281-894-5983         Tel: 86-29-8833-7252         Tel: 84-28-5448-2100         Netherlar           dianapolis         China - Xiamen         Tel: 31-41         Fax: 31-41           bblesville, IN         Tel: 86-592-2388138         Fax: 31-41           d: 317-773-8323         China - Zhuhai         Norway -           ax: 317-773-5453         Tel: 86-756-3210040         Tel: 47-72           bs Angeles         Fax: 34-4         Fax: 34-4         Fax: 34-4           ax: 949-462-9608         Fax: 34-4         Fax: 34-9         Fax: 34-9           at: 949-462-9608         Fax: 34-9         Fax: 34-9         Fax: 34-9           at: 919-844-7510         Fax: 34-9         Fax: 34-9         Fax: 34-9	
H: 248-848-4000       Tel: 86-27-5980-5300       Tel: 66-2-694-1351       Italy - Par         buston, TX       China - Xian       Vietnam - Ho Chi Minh       Tel: 39-04         cl: 281-894-5983       Tel: 86-29-8833-7252       Tel: 84-28-5448-2100       Netherlar         clianapolis       China - Xiamen       Tel: 84-28-5448-2100       Netherlar         cblesville, IN       Tel: 86-592-2388138       Fax: 31-41         ch: 317-773-8323       China - Zhuhai       Norway -         ax: 317-773-5453       Tel: 86-756-3210040       Tel: 47-72         ch: 317-536-2380       Poland -       Tel: 48-22         psion Viejo, CA       Romania       Tel: 48-29         d: 949-462-9608       Tel: 54-91       Spain - M         d: 951-273-7800       Tel: 34-91       Fax: 34-9         aleigh, NC       1919-844-7510       Sweden -	
Duston, TX         China - Xian         Vietnam - Ho Chi Minh         Tel: 39-04           di: 281-894-5983         Tel: 86-29-8833-7252         Tel: 84-28-5448-2100         Netherlar           dianapolis         China - Xiamen         Tel: 31-41         Fax: 31-41           oblesville, IN         Tel: 86-592-2388138         Fax: 31-41           d: 317-773-8323         China - Zhuhai         Norway -           ax: 317-773-5453         Tel: 86-756-3210040         Tel: 47-72           d: 317-536-2380         Poland -         Tel: 48-22           ps Angeles         Tel: 949-462-9523         Tel: 40-21           ax: 949-462-9608         Spain - M         Tel: 34-91           d: 919-844-7510         Fax: 34-9         Sweden -	
I: 281-894-5983       Tel: 86-29-8833-7252       Tel: 84-28-5448-2100       Netherlar         I: 281-894-5983       China - Xiamen       Tel: 31-41         I: 281-894-5983       Tel: 86-592-2388138       Fax: 31-4         I: 281-773-8323       China - Zhuhai       Fax: 31-4         I: 317-773-5453       Tel: 86-756-3210040       Tel: 47-72         I: 317-536-2380       Fel: 86-756-3210040       Tel: 48-22         I: 317-536-2380       Fel: 86-756-3210040       Tel: 48-22         I: 317-536-2380       Fel: 86-756-3210040       Tel: 48-22         I: 949-462-9523       Tel: 40-21       Tel: 40-21         I: 949-462-9608       Fel: 34-91       Fax: 34-9         I: 951-273-7800       Fax: 34-9       Spain - M         I: 919-844-7510       Sweden -       Sweden -	
dianapolis         China - Xiamen         Tel: 31-41           oblesville, IN         Tel: 86-592-2388138         Fax: 31-4           d: 317-773-8323         China - Zhuhai         Fax: 31-4           ax: 317-773-6453         China - Zhuhai         Norway -           ax: 317-773-6453         Tel: 86-756-3210040         Tel: 47-72           bs Angeles         Tel: 86-756-3210040         Tel: 48-22           ission Viejo, CA         Romania         Tel: 40-21           ax: 949-462-9523         Tel: 49         Tel: 40-21           ax: 949-462-9608         Spain - M         Tel: 34-91           aleigh, NC         Fax: 34-9         Sweden -           al: 919-844-7510         Sweden -         Sweden -	
bblesville, IN       Tel: 86-592-2388138       Fax: 31-4         1: 317-773-8323       China - Zhuhai       Norway -         ax: 317-773-6453       Tel: 86-756-3210040       Tel: 47-72         bs Angeles       Tel: 86-756-3210040       Tel: 48-22         ission Viejo, CA       Romania         d: 949-462-9523       Tel: 48-22         ax: 949-462-9608       Spain - M         d: 951-273-7800       Tel: 34-91         aleigh, NC       Fax: 34-9         d: 919-844-7510       Sweden -	
Al: 317-773-8323       China - Zhuhai       Norway -         ax: 317-773-5453       Tel: 86-756-3210040       Tel: 47-72         b: 317-536-2380       Poland -       Poland -         b: 317-536-2380       Tel: 86-756-3210040       Tel: 47-72         b: 317-536-2380       Poland -       Tel: 48-22         b: 300, CA       Romania       Tel: 40-21         al: 949-462-9523       Tel: 40-21       Spain - M         al: 951-273-7800       Tel: 34-91       Fax: 34-91         aleigh, NC       Fax: 34-9       Sweden -         al: 919-844-7510       Sweden -       Sweden -	
ax: 317-773-5453       Tel: 86-756-3210040       Tel: 47-72         bx Angeles       Foland -         ission Viejo, CA       Romania         id: 949-462-9523       Tel: 40-21         ak: 951-273-7800       Spain - M         aleigh, NC       Fax: 34-9         id: 919-844-7510       Sweden -	
H: 317-536-2380       Poland -         Ds Angeles       Tel: 48-22         ission Viejo, CA       Romania         h: 949-462-9523       Tel: 40-21         ax: 949-462-9608       Spain - M         h: 951-273-7800       Tel: 34-91         aleigh, NC       Fax: 34-9         h: 919-844-7510       Sweden -	
ss Angeles         Tel: 48-22           ission Viejo, CA         Romania           d: 949-462-9523         Tel: 40-21           ax: 949-462-9608         Spain - M           d: 951-273-7800         Tel: 34-91           aleigh, NC         Fax: 34-9           d: 919-844-7510         Sweden -	
sission Viejo, CA         Romania           d: 949-462-9523         Tel: 40-21           ax: 949-462-9608         Spain - M           d: 951-273-7800         Tel: 34-91           aleigh, NC         Fax: 34-9           d: 919-844-7510         Sweden -	
H: 949-462-9523     Tel: 40-21       ax: 949-462-9608     Spain - M       H: 951-273-7800     Tel: 34-91       aleigh, NC     Fax: 34-9       H: 919-844-7510     Sweden -	
ax: 949-462-9608     Spain - M       al: 951-273-7800     Tel: 34-91       aleigh, NC     Fax: 34-9       al: 919-844-7510     Sweden -	
II: 951-273-7800     Tel: 34-91       aleigh, NC     Fax: 34-9       II: 919-844-7510     Sweden -	
aleigh, NC Fax: 34-9 I: 919-844-7510 Sweden -	
I: 919-844-7510 Sweden -	
ew tork, int lef: 46-31	-
1: 621 425 6000	
	- Stockholm
	5090-4654
I: 408-735-9110 UK - Wok	-
	18-921-5800
	18-921-5820
l: 905-695-1980 ax: 905-695-2078	

单击下面可查看定价,库存,交付和生命周期等信息

>>Microchip Technology